

TILLAMOOK COUNTY REWITNESS #73

MEANDER COR. SEC. 4T3 T 2N R 10 W., WM.


HISTORICAL: GLO T2NR10W PAGE 35
 SET POST 1873 26" SPR. N80°E 7 IKS FOUND
 5" HEM. N55°W 9 IKS FOUND
 MAP B-5 (SEE FIELD NOTES) WEA.

CONDITION	FOUND:
BADLY RUSTED	1" IRON PIPE ± 8" HIGH
UPROOTED	5" HEM N55°W 9 IKS GLO PAGE 35
FOUND REMAINS OF STUMP	26" SPR N80°E 7 IKS GLO PAGE 35
FOUND UPROOTED	20" HEM N80°E 2D ⁸ W.E. ANDERSON FIELD NOTES

COMMENTS:

REWITNESS

I SET 2½" IRON PIPE WITH 3" BRASS CAP IN 8" TILE AND
 CONCRETE OVER FOUND 1" IRON PIPE
 *70 " Hat Section S. ± 3² FT.

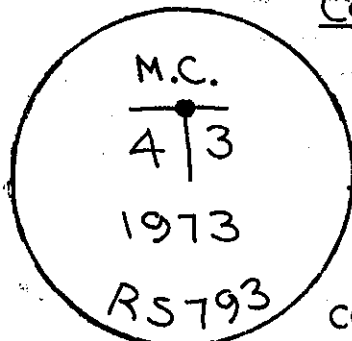

NEW ACCESSORY:

*8" SPRUCE N10°17'W 29 ¹⁵	MC BT S4.5
*38" SPRUCE S79°22.5'E 56 ⁸⁴	MC BT S3.5

COMMENTS: I PLACED (2) 8" DIA. X 12" HIGH TILE WITH
 90 LBS. CONCRETE MIX AT THIS CORNER. I CLEARED AN AREA
 AROUND THE CORNER OF 25 FEET IN DIAMETER. A SMALL
 BROOK IS ± 21° EAST OF CORNER. -- WATCH OUT FOR A 3 FOOT DIA. X
 2½ FOOT HOLE AT THE BROOK. IN THE PRESENCE OF:

W. G. Arthur
 G. W. Urrey
 A. E. Duncan R5793

DATE: MAY 1973

PHOTO#: *[Signature]*

Co Surveyor
 TITLE

* = County corner tag affixed.