
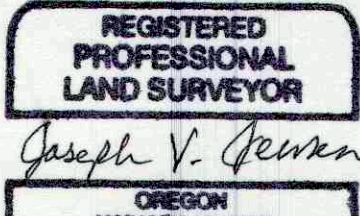


**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
Tillamook County Surveyor's Office

<b>SECTION:</b> Meander Corner Sections 31 and 32	<b>TOWNSHIP</b> 4 South	<b>RANGE</b> 10 West
<b>COUNTY:</b> Tillamook		<b>DATE:</b> 05-10-15
<b>CORNER DESIGNATION:</b> The Meander Corner common to Sections 31 and 32, T. 4 S., R. 10 W., W.M.		<b>(Please check one)</b>
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
		<input checked="" type="checkbox"/> Referenced Out
<b>Previous Rewitnesses, Restorations and Surveys, etc:</b> See maps B-1759, B-3323, P-335, Tillamook County Survey Records; Tillamook County Corner Rewitness Card number 795; Tillamook County Corner Book 6, Page 422; Tillamook County Rewitness Records.		
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found the 10" cast iron monument case and the 3" Tillamook county brass cap to be covered by asphalt pavement. This corner is positioned between two high speed curves on Brooten County Road making it very dangerous and difficult to work on. We decided not to dig up the new asphalt pavement so we set 2 reference monuments in the asphalt at the shoulder of the eastbound lane which are described below.		
Found a nail, no brass Tillamook County washer in a scribed triangle on the side of power pole number 321506 which bears South 8° West 61.30' at position, Power pole number was #060000 (Rewitness Book 6, Page 422); The 84" hat section post set at North 72° East 10.6' is gone (Rewitness Book 6, Page 422); Found the rotten 30" x 7' high Spruce stump, axe marks visible, no scribing visible, which bears South 17° West 60.40' at position (Rewitness Book 6, Page 422); Rotten 28" x 8' high Spruce stump, scribing visible, which bears South 97.45' (Rewitness Book 6, Page 422) is now gone.		
<b>Monument Set (Procedures and Description):</b> We referenced the position of the found 3" diameter Tillamook County Brass cap at the Meander Corner. See Rewitness Book 6, page 422, Tillamook County Rewitness Records for the information regarding the setting of the 3" diameter brass cap. Reference monument 'A' stamped "Tillamook County Surveyor 2015 R M N 6-51 E 45.93".  Reference monument 'B' stamped "Tillamook County Surveyor 2015 R M S 84-19 E 22.77".	<b>Pictures of Set Monuments:</b>	
	<div style="display: flex; justify-content: space-around;"> <div style="text-align: center;">A.)</div> <div style="text-align: center;">B.)</div> </div> 	
<b>New accessories set:</b> Set 2 – 2 ½" diameter Tillamook County Surveyor aluminum caps stamped as shown above.		
<b>New Bearing Trees set:</b> No new bearing trees were set.		
<b>Location &amp; Comments:</b> The corner is located in the westbound lane of Brooten County road.		
<b>Firm / Agency</b> Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		<b>SURVEYOR'S SEAL</b>
<b>Party Chief:</b> Joe Jensen, P.L.S. 60067, Survey Supervisor		
<b>Notes:</b> Digital images were taken of the set reference monuments and are shown above.		
<b>Witnesses:</b> Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, P.L.S. 86926, Survey Technician		

