## OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT

Tillamook County Surveyor's Office

SECTION: 31, 32, 6 and 5	TOWNSHIP: 1 and 2 South	RA	NGE: 10 West
COUNTY: Tillamook		DATE: 1/18/2023	
CORNER DESIGNATION: Section corner common to sections 31 & 32, Township 1 South, Range 10 West and Section corner 6 & 5, Township 2 South, Range 10 West, Willamette Meridian, Tillamook County, Oregon.		(Please check one)	
			Condition Report Only
		100	Restoration
		x	Rewitness
			Unrecorded
			Reset at surface
			Referenced Out

Previous Rewitnesses, Restorations and Surveys, etc... Original G.L.O. field notebook 2S 10W pg. 8 (1857); Book 10, Page 89 (1892); C-147 (1947); Book 4, Page 55 (1949); Book 3 Page 50 (1964); Rewitness Card #330 and #448 (1971); Book 6, Page 416 (1989).

History, condition, and sources: In 1857 under G.L.O. contract number 67 the section corner Post was set and 4 bearing trees were established. In 1892 (Bk. 10, pg. 89) Post was set and 4 new bearing trees were established. In 1947 (C-147) W.E. Anderson set ¾" Iron Pipe. In 1949 (Bk. 4, pg. 55) W.E. Anderson established 4 new bearing trees with bearings to a ¾" Iron Pipe. In 1964 (Bk. 3, pg. 50) John L. Carlich set a yellow 2"x 4" 6 inches South of corner for marker. The four previous bearing trees were located, and one new bearing tree was established. In 1969 John L. Carlich replaced the ¾" Iron Pipe with a 3" Tillamook County Brass Cap (Rewitness Card #330 and #448) Tillamook County Survey Office found 5 bearing trees and 1 rotten stump from a dead bearing tree. 8" tile and cement were set around the found 3" Tillamook County Brass Cap. An 86" Hat Section Post was set 12.8' South. In 1989 (Bk. 6, pg. 416) Tillamook County Survey Office found a 3" Tillamook County Brass Cap in concrete, 5 bearing trees and 1 rotten stump from an old bearing tree. The Hat Section Post was gone so a new 84" Hat Section Post was added 1.5' South. In 2023 (Field Bk. MR 14, pg. 39-40) Tillamook County Surveyor office visited the section corner and found a 3" Tillamook County Brass Cap (stamped "R10W T1S S31 S32 S6 S5 T2S 1969 RS 287") in concrete as shown hereon in good condition. Found white painted 4"x 4" cedar post broken on ground next to monument. All previous bearing trees are now gone. Established four new bearing trees.

Found: Hat Section Post with yellow metal location tag South 1.5' Found: white painted 4"x 4" cedar post broken on ground next to monument.

## New accessories set:


22" Spruce scribed "T1SR10WS32BT" with nail and "TILL CO. SURVEYOR" washer between the B&T and yellow metal location tag. N. 58° W. 9.5'

23" Spruce scribed "T2SR10WS5BT" with nail and "TILL CO. SURVEYOR" washer between the B&T and yellow metal location tag. S. 58° E. 11.2'

12" Fir scribed "T2SR10WS6BT" with nail and "TILL CO. SURVEYOR" washer between the B&T and yellow metal location tag. S. 63° W. 28.7'

14" Hemlock scribed "T1SR10WS31BT" with nail and "TILL CO. SURVEYOR" washer between the B&T and yellow metal location tag N. 79° W. 25.4'

**Pictures of Found Monuments:** 

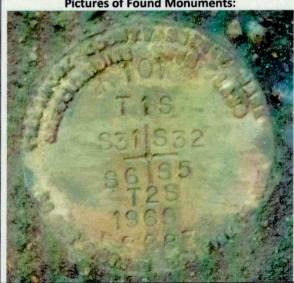

Location: This corner is located in Netarts, approximately 175' South of Pearl Street and approximately 110' Westerly of Park Street.

Tillamook County Surveyor office: 1510 3rd Street Suite C, Tillamook, OR. 97141

Party Chief: Travis Porter, Tillamook County Survey Supervisor

Witnesses: Michael Rice, PLS 86926, Tillamook County Surveyor Kael Poklikuha, Tillamook County Survey Technician

Notes: Digital images taken of monument and accessories.

SURVEYOR'S SEAL

REGISTERED **PROFESSIONAL** LAND SURVEYOR

OREGON DECEMBER 11, 2012 MICHAEL R. RICE 86926

RENEWAL 12-31-2024