CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

The original corner was set by Henry Meldrum in 1884. The G.L.O. performed a dependant resurvey of the township in 1933 and set a brasscap at the position of the original corner
From Which:

12" Alder S 27° E 74 Links
12" Alder S 65° W 47 Links
14" Alder N 30° W 36 Links
18" Fir N 52° E 78 Links

DIAGRAM

T 4 S R 8 W W.M.

3	2
10	11

u

Description of corner evidence found:

Found 1933 brasscap on the west edge of Forest Service Road No. S494 at lip of cut back.

26" Alder S 75° W 14 feet (M. Whitmore 1948)

37" D. Fir S 30° E, 223 feet
36" D. Fir N 69° W, 85.4 feet (L. Whitmore 1969)

Description of monument and accessories I established to perpetuate the original location of this corner:

Because of the proximity of this corner to the cut bank we set a witness corner and reference monument to perpetuate this corner position.

T 4 S R 8 W

WC

S 3	S 2
S 10	S 11

1977

RLS 1073

From Which,

22" Alder S 76° E, 48.6 feet
24" Alder N 33 1/2 E, 29.2 feet
Marked "X" "BT" on both B.T.'s

T 4 S R 8 W

S 10

RM →

1977

RLS 1073

6' Steel fence post with B.T. tag attached

See map B-764

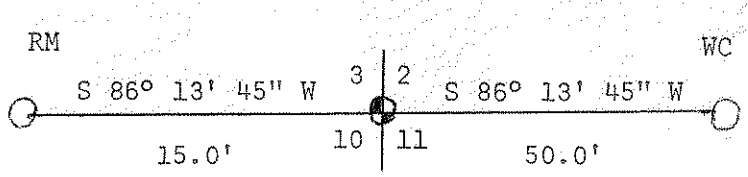

Witness: Jay McDonald

REGISTERED PROFESSIONAL LAND SURVEYOR
Kenneth M. Wightman
OREGON JULY 17, 1970 KENNETH M. WIGHTMAN II 942

Office of County Surveyor *County of* Tillamook
State of Oregon, *I hereby certify that the within instrument was filed in this office for record on the* 8th *day of* August, *19*77
(COUNTY OFFICIAL) *by* County Surveyor (DEPUTY)

REGISTERED PROFESSIONAL LAND SURVEYOR
Edgar R. Cook
OREGON JULY 30, 1976 EDGAR R. COOK 1073

Form R6-7100-57 (9/71)

D. Mike Jackson
Engineering Technician

TIMBERLAND SERVICES, INC.
1010 Airport Road P. O. Box 668
Albany, Oregon 97321
Telephone (503) 926-9404
LAND SURVEYING - ENGINEERING
LAND USE PLANNING - ROADS
FORESTRY CONSULTING

Book 6 Pg 38