

County Surveyor's Record, Tillamook County Oregon

3-16-62
S.W. 1/4

CHAINS

RESTORED CORNER FOR STATE OF OREGON-DEPARTMENT OF FORESTRY

Section corner common to Sections 1, 2, 11 and 12, T6S, R9W, W.M., Tillamook County, Oregon.

ORIGINAL

Post (missing, old angle iron in place) from which:

4 Vine Maples given in notes are all missing although the area has considerable Vine Maple second growth.

Creek, 5 links, course NE bears South 3.50 chains; now in place, NW bearing.

Creek, 25 links, course NW, bears North 13.50 chains; now in place.

Line blazes north, south, east and west.

RESTORED

Var. 21°

Set 1 1/2" x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T6S R9W S1 S2 S11 S12 1962 RS359", 24 inches in ground, over above angle iron and from which a:

48" Fir stump bears N41 1/2°W 63.3 ft.; scribed T6S R9W S2 BT.

59" Fir stump bears N21 1/2°E 21.5 ft.; scribed T6S R9W S1 BT RS359.



12" Fir bears S72 1/2°E 44.2 ft.; scribed T6S R9W S12 BT.

14" Fir on E. side of road and creek bears S44 1/2°W 102.0 ft.; scribed T6S R9W S11 BT.

Set 4 x 4 x 72" white painted Cedar post 2.0 ft. North of corner pipe. Oregon State Board of Forestry metal location poster on 59" Fir stump BT. Corner is 30 ft. east of road.

Dated March 5, 1962

Restored by

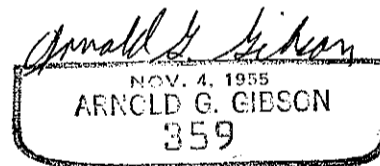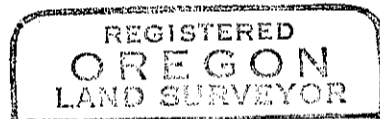

Present and witnessed by John Hollingsworth