

RESTORATION OF THE QUARTER CORNER COMMON TO
SECTIONS 22 AND 23, T3N, R9W, W.M.



At the corner I find the remains of the original 60" cedar bearing tree scribed by G.L.O. surveyor Manius Buchanan in 1893 at east 50 lks. (33 ft.) from the subject corner. Said bearing tree is now a 60" cedar stump, about 4 ft. high on the uphill side, with a rotted out face on its west side. The outside perimeter of face has definite overgrown axework, but I find no scribing. The 8" hemlock reported by Buchanan at S86°W 34 lks. has been destroyed by cat logging.

At record bearing and distance of west 33.00 ft. from face of original cedar bearing tree I set flush with ground a 5/8" X 42" rebar with yellow plastic cap stamped "K FOESTE LS 849", from which I scribed the following B.T.'s: a 5" alder bears N35°E 6.94 ft. to a 3/4" brass disk, stamped "LS 849", nailed to bark scribed "BT"; a 3" fir bears S55°E 12.35 ft. to a 3/4" brass disk, stamped "LS 849", nailed to face scribed "BT"; a 4" fir bears S34°W 19.50 ft. to a 3/4" brass disk, stamped "LS 849", nailed to face scribed "BT"; a 3" fir bears S88°W 19.83 ft. to a 3/4" brass disk, stamped "LS 849", nailed to face scribed "BT". Sawed "X" at breast height in each of the above described fir B.T.'s. Set six foot metal fence post with yellow location poster 2 feet north of corner.

Note: Bearings reported to bearing trees are hand compass bearings using a declination of 21 1/2° east. All bearing trees scribed by me are posted with yellow aluminum location tags.

Present: K. Foeste, A. Hofmann, B. Brown

Date: 3/20/2000

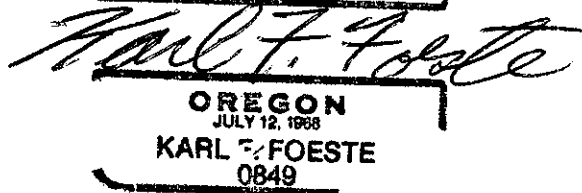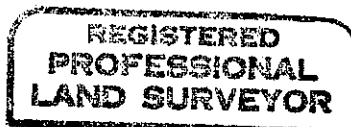

Renews 1/1/2002