
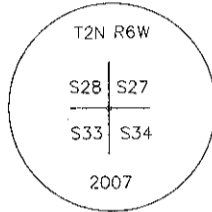
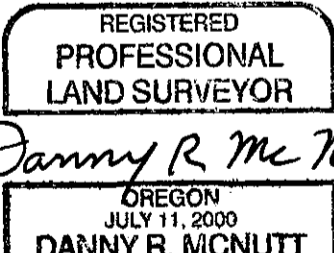


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: the SW corner of Sec. 27	TOWNSHIP: 2 North	RANGE: 6 West
COUNTY: Tillamook		DATE: 07-23-08
CORNER DESIGNATION: The Section corner common to Sections 28, 27, 33, and 34, Township 2 North, Range 6 West, W.M., Tillamook County, Oregon.	(Please check one)	
	<input type="checkbox"/>	Condition Report Only
	<input checked="" type="checkbox"/>	Restoration
	<input checked="" type="checkbox"/>	Rewitness
	<input type="checkbox"/>	Unrecorded
	<input type="checkbox"/>	Reset at surface
Previous Rewitnesses, Restorations and Surveys, etc.: Rewitness Book 1, Page 16; Rewitness Book 1, Page 171, Tillamook County Survey Records. BLM Field Note Volume: OR-R0415 Pages: 0316.00-0317.00; 0337.00.		
Found Monument(s) and Accessories (Condition & Source): We found a 2-1/2" iron pipe 30" above ground with a 1/2" iron pipe inside the 2-1/2" iron pipe. We cut the pipe approximately 12" above ground and proceeded to set the brass cap as detailed below. Original Hemlock tree is now gone. Found a badly rotten Douglas Fir stump (48" diameter with boat spike - Book 1, Page 171) but did not find a boat spike in the tree. The 30" diameter Douglas fir stump (Book 1, Page 171) is now gone. We also found a white painted cedar post South 1.0' from monument.		
Monument Set (Procedures and Description): We set a 3" diameter Tillamook County Surveyor brass cap inside of a found 2-1/2" iron pipe. The cap is stamped as shown hereon. I placed a 12" diameter plastic cylinder around the monument and filled the plastic cylinder with 120 pounds of concrete.	Sketch of Reset Monument: 	
GPS Coordinates (Horizontal Position only): <u>Geodetic</u> : 45° 37' 18.17459" N, 123° 25' 23.1126" W		
Oregon North Zone NAD '83/'91, U.S. Survey Foot : Northing = 726292.1815, Easting = 7454370.3605		
Convergence = -2° 04' 21.52988" Scale Factor = .99992587		
Other new accessories set: Set a 72" Hat Section post with yellow metal location tag North 4.0'.		
New Bearing Trees: *A 17" diameter Douglas Fir tree scribed "T2NR6WS34BT" with a nail and brass washer stamped "T.C.Surv" set between the 'B & T' which bears South 45° East 22.43'. *A 29" diameter Douglas Fir tree scribed "T2NR6WS33BT" with a nail and brass washer stamped "T.C.Surv" and set between the 'B & T' which bears South 45° West 19.35'. *A 18" diameter Douglas Fir tree scribed "T2NR6WS27BT" with a nail and brass washer stamped "T.C.Surv" and nail set between the 'B & T' which bears North 51° East 15.83'. *A 21" diameter Alder tree scribed "T2NR6WS28BT" with a nail and brass washer stamped "T.C.Surv" and nail set between the 'B & T' which bears North 9° West 47.81'. * INDICATES TILLAMOOK COUNTY YELLOW METAL LOCATION POSTER TAG ATTACHED.		
Location & Comments: This monument is located approximately 100' East of Drift Creek Road.		
Firm / Agency: Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL 
Party Chief: Joe Jensen, PLS 60067, Survey Supervisor.		
Notes:		
Witness: Danny R. McNutt, PLS 49230, Tillamook County Surveyor.		

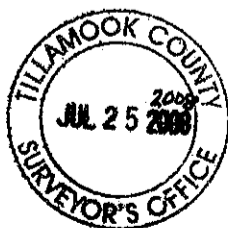

BOOK 7 445