
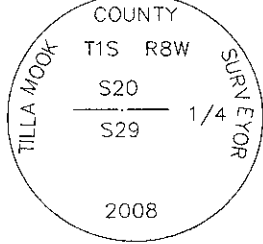


**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
Tillamook County Surveyor's Office

<b>SECTION:</b> The South one-quarter corner of Section 20	<b>TOWNSHIP</b> 1 South	<b>RANGE</b> 8 West
<b>COUNTY:</b> Tillamook		<b>DATE:</b> 07-2-08
<b>CORNER DESIGNATION:</b> The one-quarter corner common to Section 20 and Section 29, Township 1 South, Range 8 West, W.M., Tillamook County, Oregon.		<b>(Please check one)</b>
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input checked="" type="checkbox"/> Reset at surface
		<input type="checkbox"/> Referenced Out
<b>Previous Rewitnesses, Restorations and Surveys, etc:</b> Rewitness Book 6, Page 490; Rewitness Card #175; Tillamook County Survey Records. Maps not listed on previous Rewitnesses: B-1524, A-6030, A-6652, A-7569, Tillamook County Survey Records.		
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found a 3" diameter Tillamook County Brass Cap in a 10" diameter monument case with no lid, as described in Rewitness Book 6, Page 490, Tillamook County Survey Records. Found a 24" diameter Douglas Fir tree with a white metal bearing tree tag and overgrown face at record position (21" diameter fir with face overgrown in Rewitness Book 6, Page 490). Searched for, but could not find the 96" Hat Section post (N.5°W. 19.64' in Rewitness Book 6, Page 490). The 45" diameter Spruce tree set by the B.L.M. was not searched for. Searched for, but could not find the sawed off remains of Telephone pole number 242. Found a 2" diameter axle shaft (Approximately South 26.24', 1" high, origin unknown, in Rewitness Book 6, Page 490) at record position. Found a new power pole numbered 294800. No measurements were taken from corner monument to power pole.		
<b>Monument Set (Procedures and Description):</b> I set a 2" diameter Brass cap in concrete at road surface over the found 3" diameter Tillamook County Brass Cap. The 2" diameter cap is stamped as shown hereon.		<b>Sketch of Set Monument:</b> 
<b>New accessories set:</b> Set a 72" hat section post North 28°. Found a 5/8" rebar with yellow plastic cap stamped "A DUNCAN LS 793" North 28.11', the record value from Map A-5548		
<b>New Bearing Trees:</b> No new bearing trees were set.		
<b>Location &amp; Comments:</b> This corner is located approximately 3' South of the centerline in the East bound lane of Trask River Road.		
<b>Firm / Agency</b> Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		<b>SURVEYOR'S SEAL</b>  
<b>Party Chief:</b> Joe Jensen, PLS 60067, Survey Supervisor		
<b>Notes:</b>		
<b>Witnesses:</b> Danny R. McNutt, PLS 49230, Tillamook County Surveyor.		

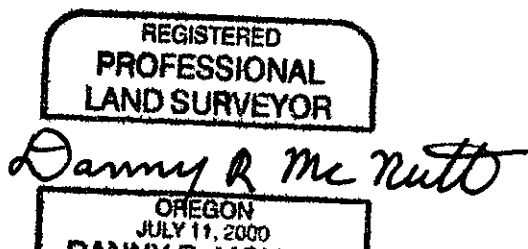