


**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
Tillamook County Surveyor's Office

<b>SECTION:</b> South 1/4 of 26	<b>TOWNSHIP</b> 2 South	<b>RANGE</b> 9 West	
<b>COUNTY:</b> Tillamook		<b>DATE:</b> 5-21-09	
<b>CORNER DESIGNATION:</b> The Quarter Corner common to Sections 26 and 35, T. 2 S., R. 9 W., W.M.		<b>(Please check one)</b>	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Reset at surface
<b>Previous Rewitnesses, Restorations and Surveys, etc:</b> BLM Field Notes Volume: OR-R0309 Page 967 (GLO 2S9 Page 52) (1884), GLO Re-survey in BLM Field Notes Volume: OR-R0567 Page 99 (1956), Tillamook County Survey Records.			
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found a 2 1/2" GLO Brass Cap up 2.0', in good condition. The monument is stamped as shown hereon. Tied the monument conventionally using GPS established control. The Oregon North Zone State Plane in NAD 83/91 grid coordinate for the monument is N = 634306.393, E = 7366165.646 US Survey Feet. (G.L.O. 1884) – Found rotten Hemlock Stub (was 20" dia.) bearing (S 48° W 22 lks.). (G.L.O. 1884) – Found rotten remains (was a 20" dia. Hemlock) bearing (N 10 1/2° W 22 lks.). (G.L.O. 1956) – Found a 16" dia. (was 12") Hemlock Stump, 4' tall, bearing (S 30° W 39 lks.), scribing "1/4 S35 BT" visible. (G.L.O. 1956) – Found rotten remains (was 13" dia. Hemlock) bearing (N 54 1/2° W 41 lks.). ( ) Indicates record information, Tillamook County Survey Records.			
<b>Monument Set (Procedures and Description):</b> Not applicable.		<b>Sketch of Found Monument:</b>	
			
<b>New accessories set:</b> Referenced the monument and re-set, up 1.0'. Set 120 lbs. of concrete in a 12" diameter cylinder, and a rock collar around the monument. Set a 5/8" X 30" Iron Rod with a Red Plastic Cap marked, "Tillamook Co. Survey", approx. 30' South of Munson Creek Logging Road #100 apparent centerline, as an occupy point to tie the monument. The Oregon North Zone State Plane in NAD 83/91 grid coordinate for the monument is N = 634074.660, E = 7366120.289 U.S. Survey Feet. Set a 5/8" X 30" Iron Rod with a Red Plastic Cap marked, "Tillamook Co. Survey", approx. 30' South of Munson Creek Logging Road #100 apparent centerline, as a backsight point to tie the monument. The Oregon North Zone State Plane in NAD 83/91 grid coordinate for the monument is N = 634275.456, E = 7364856.598 U.S. Survey Feet. Set a 72" Hat Section Post with yellow metal location poster, 3.0' South of the monument.			
<b>New Bearing Trees set:</b> *16" dia. Noble Fir bearing N 72° W 12.1', scribed, "T2S R9W 1/4 S26 BT", tagged and painted. *13" dia. Hemlock bearing N 83° E 5.1', scribed, "1/4 S26 BT", tagged and painted. *11" dia. Hemlock bearing S 1° E 8.5', scribed, "1/4 S35 BT", tagged and painted. * All new bearing trees have an aluminum nail and washer marked, "Till. Co. Surveyor" in the face of the blaze between the scribed "B" and "T".			
<b>Location &amp; Comments:</b> Corner is located approx. 200' North of Munson Creek Logging Road #100.		<b>SURVEYOR'S SEAL</b>  <div style="border: 1px solid black; padding: 5px; display: inline-block; text-align: center;">                 REGISTERED PROFESSIONAL LAND SURVEYOR   <i>Joseph V. Jensen</i>                   OREGON JANUARY 10, 2006 JOSEPH V. JENSEN 60067                   RENEWAL DATE: 06-30-2011             </div>	
<b>Firm / Agency</b> Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141			
<b>Party Chief:</b> Joe Jensen, P.L.S. 60067, Survey Supervisor			
<b>Notes:</b>			
<b>Witnesses:</b> Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician			

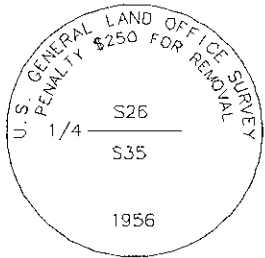