
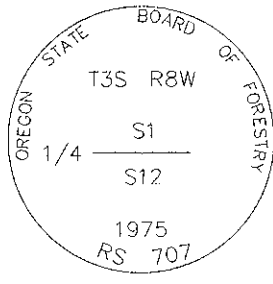


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: North ¼ corner Section 12	TOWNSHIP 3 South	RANGE 8 West	
COUNTY: Tillamook		DATE: 05-06-10	
CORNER DESIGNATION: The Quarter Corner Common to Sections 1 and 12, T. 3 S., R. 8 W., W.M.		(Please check one)	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0309 Page 0466.00 to 0467.00, 1884; Rewitness Book 5, Page 342, 1975, Tillamook County Survey Records; Survey map number B-714, Tillamook County Survey Records.		<input type="checkbox"/>	
Found Monument(s) and Accessories (Condition & Source): Found a 3" Oregon State Board of Forestry brass cap approximately 0.4' above the ground and in good condition. The monument is stamped as shown hereon. Placed a 12" diameter plastic cylinder filled with 120 pounds of concrete around the monument. GPS tied the monument directly using GPS established control. The Oregon North Zone State Plane in NAD 83/91 coordinate for the monument is N = 621911.815, E = 7400591.954, U.S. Survey Foot, Convergence = -2° 12' 38.90346", Grid Scale = 0.99989854.		<input type="checkbox"/>	
Found a 1" Iron Pipe and placed it on the ground next to the monument. Found a steel fence post with metal location tag 1.0' West. Found another steel fence post with no tag 2.0' East. (GLO Original) – Found hollow stump, no marks, found at GLO record position of S 51° E 14 lks [9.24']. (Book 5, Page 342) – Found a Hemlock tree, now an uproot with a healed face. (Was a 25" tree at S15 ½ ° E 32.2'). (Book 5, Page 342) – Found a Hemlock tree, now an uproot with a healed face. (Was a 20" tree at N 23 ¼ ° W 40.8'). () Indicates record information from Book 5, Page 342, Tillamook County Survey Records. [] Indicates conversion from links to feet.		<input type="checkbox"/>	
Monument Set (Procedures and Description): Not applicable.	Sketch of Found Monument: 		
New accessories set: Set a 72" hat section post 3.0' South of monument.			
New Bearing Trees set: 33" diameter Hemlock tree bears N 35° W 64.3', scribed, "T3SR8W1/4S1BT", tagged and painted. 20" diameter Douglas Fir bears S 89° W 128.2', scribed, "T3SR8W1/4S1BT", tagged and painted. All new bearing trees have a nail and aluminum washer marked, "Till. Co. Surveyor", in face of blaze, between the scribed 'B and T', and a yellow metal location tag affixed.			
Location & Comments: Corner is located approx. 40' South of an East-West tree line and approximately 100' East of an existing logging road.			
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL 	
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor			
Notes: Digital images were taken of the found monument, the new monument, the record bearing trees and new accessories.			
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician			

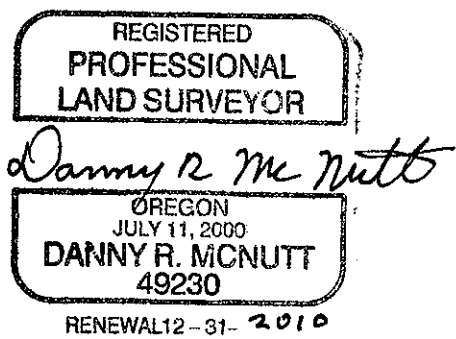