
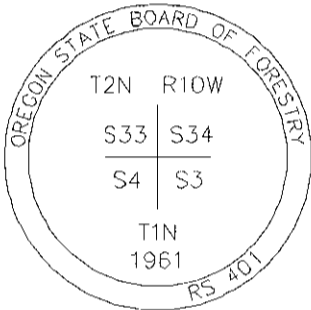


**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
Tillamook County Surveyor's Office

<b>SECTION: SE COR 33</b>	<b>TOWNSHIP 2 North</b>	<b>RANGE 10 West</b>
<b>COUNTY: Tillamook</b>		<b>DATE: 5-13-10</b>
<b>CORNER DESIGNATION:</b> The Section Corner common to Sections 33,34 T. 2 N. R. 10 W. and Sections 3, 4 T. 1N. R. 10 W.		<b>(Please check one)</b>
		<input type="checkbox"/> Condition Report Only <input type="checkbox"/> Restoration <input checked="" type="checkbox"/> Rewitness <input type="checkbox"/> Unrecorded <input type="checkbox"/> Reset at surface <input type="checkbox"/> Referenced Out
<b>Previous Rewitnesses, Restorations and Surveys, etc:</b> BLM Field Notes Volume: OR-R0122 Page 57, (GLO Book 1N10 Page 32) (1873), Map B-437 (1959), Rewitness Book 2 Page 489 (1961), Tillamook County Survey Records.		
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found a 3" diameter O.S.B.F. Brass Cap under the root system of a 12" dia. Hemlock, down 0.5'. No original evidence was found and the monument was proportioned on Map B-437 (1959). Rewitness Book 2 Page 489 was the corner report reflecting the work done on Map B-437. The intent of this rewitness is to perpetuate the position of the proportioned corner. Found a white painted cedar post lying near the monument. (Map B-437) – Found rotten remains of (32" Hemlock bears S 78° W 7.7'), no visible marks. (Map B-437) – Found rotten remains of (30" Hemlock bears S 15° E 2.2'), no visible marks. (Map B-437) – Found rotten remains of (14" Hemlock bears N 11 1/2° W 15.9'), no visible marks. (Map B-437) – Found rotten remains of (16" Hemlock bears N 77° E 39.2'), no visible marks. ( ) Indicates record information, Tillamook County Survey Records.		
<b>Monument Found (Procedures and Description):</b> After felling the Hemlock and cutting out the root system to expose the monument, we ran a control traverse to the monument from GPS established control. The Oregon North Zone State Plane in NAD 83/91 grid coordinate for the position is N = 726075.430, E = 7330887.101 U.S. Survey Feet. Convergence = -2°24'52.59333", Grid Scale = 0.99992388.		<b>Sketch of Found Monument:</b> 
<b>New accessories set:</b> Set 120 lbs. of concrete in a 12" dia. cylinder around the monument. Set 72" hat section post with a yellow metal location tag East 3.0' from the monument.		
<b>New Bearing Trees set:</b> *18" dia. Spruce bears N 4° W 17.6' scribed, "T2N R10W S33 BT", tagged and painted. *19" dia. Spruce bears N 73° E 26.7' scribed, "T2N R10W S34 BT", tagged and painted. *19" dia. Spruce bears S 33° E 17.0' scribed, "T1N R10W S3 BT", tagged and painted. *15" dia. D. Fir bears S 87° W 26.9' scribed, "T1N R10W S4 BT", tagged and painted. * Indicates an aluminum nail with a washer marked, "Till. Co. Surveyor" in the face of the blaze between the scribed "B" and "T" and a yellow metal location tag affixed.		
<b>Location &amp; Comments:</b> Monument is located approximately 150' West of a gravel logging road spur.		<b>SURVEYOR'S SEAL</b>  <div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;">         REGISTERED PROFESSIONAL LAND SURVEYOR       </div>  <div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;">         OREGON JANUARY 10, 2008 JOSEPH V. JENSEN 60067       </div> RENEWAL DATE: 08-30-2011
<b>Firm / Agency</b> <b>Address:</b> TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		
<b>Party Chief:</b> Joe Jensen, P.L.S. 60067, Survey Supervisor		
<b>Notes:</b> Digital images were taken of the monument and the new accessories.		
<b>Witnesses:</b> Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician		

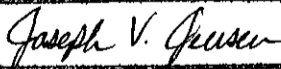