

OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: SE COR 10	TOWNSHIP 2 South	RANGE 7 West
---------------------------	-------------------------	---------------------


COUNTY: Tillamook	DATE: 5-27-10
--------------------------	----------------------

CORNER DESIGNATION: The Section Corner common to Sections 10, 11, 14 and 15, T. 2 S., R. 7 W., W.M.	<p align="center">(Please check one)</p> <input type="checkbox"/> Condition Report Only <input type="checkbox"/> Restoration <input checked="" type="checkbox"/> Rewitness <input type="checkbox"/> Unrecorded <input type="checkbox"/> Reset at surface <input type="checkbox"/> Referenced Out
--	--

Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0345 Pages 259 - 260, (GLO Book 2S7 Page 19) (1891), Rewitness Book 2 Page 82 (1951), Rewitness Book 6 Page 261 (1984), Tillamook County Survey Records.

Found Monument(s) and Accessories (Condition & Source): Found a 3" diameter O.S.B.F. Brass Cap under the root system of an Alder, down 1.0', as restored in Book 6, Page 261. Found a white painted cedar post bearing (S 37° E 3.3').
 (G.L.O.) – Did not find the (12" Alder bears S 53° E 37 lks. [24.42']).
 (G.L.O.) – Did not find the (14" Alder bears N 8 1/2° E 39 lks. [25.74']).
 (G.L.O.) – Did not find the (12" Hemlock bears S 45 3/4° W 39 lks. [25.74']).
 (G.L.O.) – Did not find the (16" Hemlock bears N 84° W 113 lks. [74.58']).
 (Book 2, Page 82) – Did not find the (10" Alder bears N 27 1/2° W 44 lks. [29.04']).
 (Book 2, Page 82) – Did not find the (5" Alder bears N 8° E 42 lks. [27.72']).
 (Book 2, Page 82) – Did not find the (5" Alder bears S 58° E 105 lks. [69.3']).
 (Book 2, Page 82) – Found (42" Fir Stump), badly rotten, bears (S 30° W 122 lks. [80.52']), scribing "T2SR7WS15BT142" visible.
 (Book 6, Page 261) – Did not find the (4" Fir bears S 84° W 75.4').
 (Book 6, Page 261) – Found 15" Alder (was 9") bears (N 46° E 6.3'), scribing visible and yellow metal location tag affixed.
 (Book 6, Page 261) – Found 25" Alder (was 15") bears (S 55° W 38.3'), scribing visible and yellow metal location tag affixed.
 (Book 6, Page 261) – Found 15" Alder (was 13") bears (S 55° E 71.5'), scribing visible and yellow metal location tag affixed.
 () Indicates record information, Tillamook County Survey Records.
 [] Indicates converted value from links to feet.

Monument Found (Procedures and Description): After cutting out the root system to expose the monument, we ran a control traverse to the monument from GPS established control. The Oregon North Zone State Plane in NAD 83/91 grid coordinate for the position is N = 647592.138, E = 7425405.984 U.S. Survey Feet. Convergence = -2°08'46", Grid Scale Factor = 0.99990286.

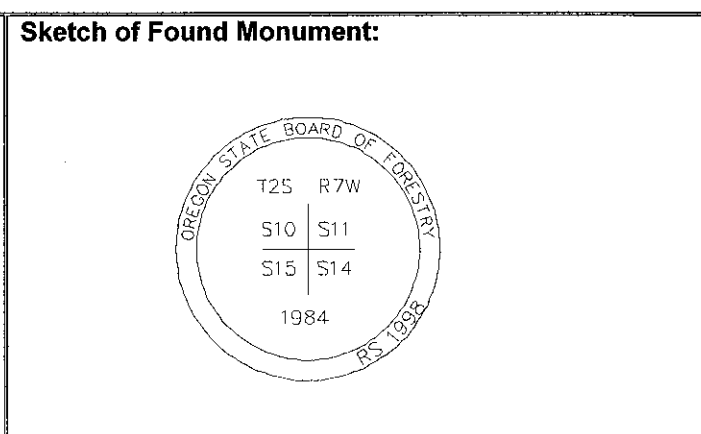

New accessories set: Set 120 lbs. of concrete in an irregular mass around monument. Set 72" hat section post with a yellow metal location tag South 2.0' from the monument.

New Bearing Objects set:
 Set a 5/8" X 30" Iron Rod with a Red Plastic Cap marked "Tillamook Co. Survey" on the top of the bank of the creek. Said Iron Rod bears *S 15°29'24" W 119.47' from the monument.
 Set a 5/8" X 30" Iron Rod with a Red Plastic Cap marked "Tillamook Co. Survey" as a reference to the corner. Said Iron Rod bears *N 80°59'44" E 129.51' from the monument.
 * Indicates bearings and distances were converted from grid to ground.

Location & Comments: Monument is located approximately 10 feet East of Bark Shanty Creek running Northerly and 20 feet North of a Creek running Northwesterly.

Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141	SURVEYOR'S SEAL
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor	
Notes: Digital images were taken of the monument, the terrain and the accessories.	
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician	

