
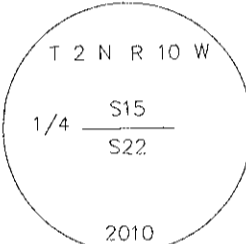


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 15 & 22	TOWNSHIP 2 North	RANGE 10 West
COUNTY: Tillamook		DATE: 12-29-10
CORNER DESIGNATION: The Quarter Corner common to Section 15 and Section 22, Township 2 North, Range 10 West, W.M., Tillamook County, Oregon.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
<input type="checkbox"/> Referenced Out		
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0122 Page: 0136 (1873); Tillamook County GLO Book 2 North, Page 31; Map B-380, Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found a 1-1/2" iron pipe with a wood hub and tack, leaning on an Easterly facing slope. The found iron pipe was straightened and then replaced by a 3" diameter Tillamook County brass cap, 0.6' above the ground. The brass cap is stamped as shown hereon. (1873 G.L.O.) – Did not find the 36" diameter Hemlock bearing N 20° E 7 links = 4.62' U.S. Survey Foot. (1873 G.L.O.) – Did not find the 10" diameter Hemlock bearing S 3° E 38 links = 25.08' U.S. Survey Foot. (Map B-380) – Found a +/- 36" diameter rotten Hemlock stump (was a 36" diameter Hemlock bearing S 60° W 4.10'), no scribes visible, and 5' tall. The Hemlock stump was found at record position. (Map B-380) – Found a +/- 30" diameter rotten Hemlock stump (was a 30" diameter Hemlock bearing N 11° E 5.46'), no scribes visible, and 3' tall. The Hemlock stump was found at record position. (Map B-380) – Did not find the 5" x 6" x 60" post +/- 3' SW. () Indicates record information from Tillamook County Survey Records.		
Monument Set (Procedures and Description): The found iron pipe was straightened and then referenced out and replaced by a 36" long x 2" diameter iron pipe and a 3" diameter Tillamook County brass cap, 0.6' above the ground. Placed 120 lbs. of concrete in a 12" diameter cylinder around the set monument. This monument was rewitnessed to perpetuate the position established by John Carlich, L.S. 287 in November of 1958 on map B-380, Tillamook County Survey Records.	Sketch of Set Monument: 3" diameter Tillamook County Surveyor Brass Cap 	
New accessories set: Set a 72" hat section post 3.0' South of monument.		
New Bearing Trees set: *19" diameter Douglas Fir tree bears S 40° 30' E 7.9', scribed "T2NR10W1/4S22BT", tagged and painted. *19" diameter Douglas Fir tree bears N 89° E 22.5', scribed "T2NR10W1/4S15BT", tagged and painted * Indicates yellow metal location tag affixed to new bearing tree. All new bearing trees have a nail and aluminum washer marked, "Till. Co. Surveyor", in face of blaze, between the scribed B and T.		
Location & Comments: Corner is located approximately 100' Southerly of the Crossover logging road.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL <div style="border: 1px solid black; padding: 5px; text-align: center;"> REGISTERED PROFESSIONAL LAND SURVEYOR </div>  <div style="border: 1px solid black; padding: 5px; text-align: center;"> OREGON JANUARY 10, 2006 JOSEPH V. JENSEN 60067 </div> RENEWAL DATE: 06-30-2011
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor		
Notes: Digital images were taken of the new monument and accessories.		
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor. Michael R. Rice, L.S.I. 16723, Survey Technician		

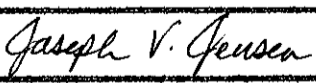