



**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
Tillamook County Surveyor's Office

<b>SECTION:</b> East 1/4 corner Section 12	<b>TOWNSHIP</b> 3 South	<b>RANGE</b> 8 West
<b>COUNTY:</b> Tillamook		<b>DATE:</b> 08-15-11
<b>CORNER DESIGNATION:</b> The Quarter Corner Common to Section 7, T. 3 S., R. 7 W. and Section 12, T. 3 S., R. 8 W., W.M.	<b>(Please check one)</b>	
	<input type="checkbox"/>	Condition Report Only
	<input type="checkbox"/>	Restoration
	<input checked="" type="checkbox"/>	Rewitness
	<input type="checkbox"/>	Unrecorded
	<input type="checkbox"/>	Reset at surface
<input type="checkbox"/> Referenced Out		
<b>Previous Rewitnesses, Restorations and Surveys, etc:</b> BLM Field Notes Volumes: OR-R0267 Pages 175-176 (GLO 3S7 Page 16) (1883), OR-R0569 Pages 388-389 (1960); Map A-859 (1960), OR-R0682 Page 44 (2003), Rewitness Book 7 Page 560 (2010), Tillamook County Survey Records.		
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found a 3" Bureau of Land Management brass cap approximately 1.0' above the ground and in good condition. The monument is stamped as shown hereon. Found a steel fence post 2.5' Northeastly, leaning, with a yellow metal location tag. Placed a 12" diameter plastic cylinder filled with 120 pounds of concrete around the monument. GPS tied the monument directly using GPS established control. The GPS control point is BLAI (BLAINE) established by the Tillamook County HARN (High Accuracy Reference Network). This was a single-occupation observation only. The Oregon North Zone State Plane in NAD 83/91 coordinate for the monument is N = 619441.746, E = 7403190.560, U.S. Survey Foot, Convergence = -2° 12' 12.18168, Grid Scale = 0.99989823. (G.L.O.) – Did not find the (8" Hemlock bears N 84° W 27 lks. [17.82']). (G.L.O.) – Found rotten remains of (7" Hemlock bears N 78° E 39 lks. [25.74']). (BLM Field Notes OR-R0569) – Found the (50" diameter Fir stump bears N 74° E 45 lks. [29.7']), no scribing visible. (BLM Field Notes OR-R0569) – Found the (42" diameter Fir stump bearing N 83° W 29 1/2 lks. [19.47']), scribing visible. (BLM Field Notes OR-R0682) – Found Hemlock uproot (bears S 22 3/4° W 7.6'), scribing visible. (BLM Field Notes OR-R0682) – Found 40" dia. Fir, (was 15"), (bears N 45° E 49.3'), scribing visible and a gray BLM tag affixed. (BLM Field Notes OR-R0682) – Found 3/4" aluminum pipe, no cap, bears N 51°49'44" W 34.11' (N 51°50'22" W 34.14'). ( ) Indicates record BLM information [ ] Indicates conversion from links to feet.		
<b>Monument Set (Procedures and Description):</b> Not applicable.	<b>Sketch of Found Monument:</b> 	
<b>New accessories set:</b> Set a 72" hat section post 3.0' North of monument.		
<b>New Bearing Trees set:</b> No new bearing trees set.		
<b>Location &amp; Comments:</b> The corner is located at the end of a spur road approx. 50' East of the end of the road.		<b>SURVEYOR'S SEAL</b>  <div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 5px auto;">REGISTERED PROFESSIONAL LAND SURVEYOR</div>  <div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 5px auto;">OREGON JANUARY 10, 2006 JOSEPH V. JENSEN 60067</div> <small>RENEWAL DATE: 03-30-2013</small>
<b>Firm / Agency</b> Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		
<b>Party Chief:</b> Joe Jensen, P.L.S. 60067, Survey Supervisor		
<b>Notes:</b> Digital images were taken of the found monument, the record bearing trees and new accessories.		
<b>Witnesses:</b> Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician		

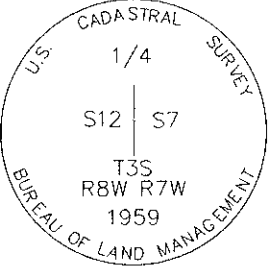