


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 4 and 3	TOWNSHIP 1 North	RANGE 10 West
COUNTY: Tillamook		DATE: 10-20-11
CORNER DESIGNATION: The Quarter Corner common to Sections 3 and 4, T. 1 N., R. 10 W., W.M.		(Please check one)
		<input checked="" type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
<input type="checkbox"/> Referenced Out		
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0122 Page 81 (GLO 1N10 Page 45, 1873), Rewitness Book 10 Page 138 (1896), Map B-437 (1959), Rewitness Book 2 Page 490 (1961), Rewitness Book 6 Page 453 (1990), Map B-3402 (2010), Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found a 3" O.S.B.F. Brass Cap in concrete. The monument is not at original position. It was re-established by midpoint on Map B-437. The monument is stamped as shown hereon. Found hat section post with tag (S 50° E 1.7') set in 1990. Found white painted cedar post North 1.5' from the monument. Double occupied the monument using GPS established control. The Oregon North Zone State Plane in NAD 83/91 grid coordinate position for the monument is N = 723348.583, E = 7330847.061, U.S. Feet. Lat: N = 45°36'01.38231" Long: W = 123°54'17.88751". (Book 2, Page 490) – Did not find the (22" Hemlock bearing S 44 1/2° W 61.8'). (Book 2, Page 490) – Did not find the (12" Hemlock bearing N 36 1/2° E 42.7'). (Book 6, Page 453) – Did not find the (12" Hemlock bearing S 11° E 12.41'). (Book 6, Page 453) – Did not find the (10" Hemlock bearing N 30° W 8.63'). (Map B-3402) – Found 5/8" Iron Rod with Y.P.C. "Terry Jones LS 2507" (bearing S 88°29'30" W 30.00') in center of road. (Map B-3402) – Found 1/2" Iron Rod with center punch (bearing S 59°11'39" W 23.67') in center of gravel logging road. (Map B-3402) – Found 5/8" Iron Rod with Y.P.C. "Terry Jones LS 2507" (bearing S 1°30'30" E 50.00') in center of road. () Indicates record information from Tillamook County Survey Records.		
Monument Set (Procedures and Description): N/A	Sketch of Found Monument: 	
New accessories set: N/A		
New Bearing Trees set: No suitable Bearing Trees in the area.		
Location & Comments: Corner is located in a recent clear cut, approx. 30' Northeasterly of Rockaway Crossover road, on the top of a steep ridge.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL <div style="border: 2px solid black; padding: 5px; display: inline-block; text-align: center;"> REGISTERED PROFESSIONAL LAND SURVEYOR </div> <i>Joseph V. Jensen</i> <div style="border: 2px solid black; padding: 5px; display: inline-block; text-align: center;"> OREGON JANUARY 10, 2008 JOSEPH V. JENSEN 60067 </div> RENEWAL DATE: 06-30-2013
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor		
Notes: Digital images were taken of the monument and its accessories.		
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor. Michael R. Rice, L.S.I. 16723, Survey Technician		

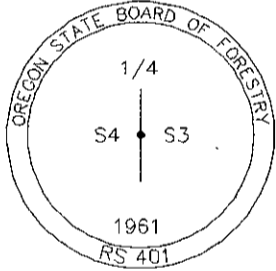