


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: West One-quarter Section 14	TOWNSHIP 1 North	RANGE 10 West	
COUNTY: Tillamook		DATE: 10-20-11	
CORNER DESIGNATION: The West One-Quarter Corner of Section 14, T. 1 N., R. 10 W., W.M.		(Please check one)	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Reset at surface
		<input type="checkbox"/>	Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0122 Page 72 (GLO 1N10 Page 45, 1873), Rewitness Book 1 Page 12, Rewitness Book 6 Page 260, Tillamook County Survey Records.			
Found Monument(s) and Accessories (Condition & Source): Found a 3" O.S.B.F. Brass Cap upright and in good condition. Placed a 12" diameter plastic cylinder and 120 pounds of concrete around the found monument. The monument is stamped as shown hereon. Found a white painted cedar post Southwesterly approximately 1.0' (was S 45° W 0.6' -- See Rewitness Book 6, Page 260) from the monument. The Oregon North Zone State Plane in NAD 83/91 grid coordinate position for the monument is N = 712640.902, E = 7335528.089, U.S. Feet. Geodetic is Lat: N = 45°34'17.69530" Long: W = 123°53'05.79667". The original bearing trees set on July 8, 1873 by C. J. Handley are now gone. The bearing trees set on August 25, 1887 by R. R. Hayes and recorded in Rewitness Book 1, Page 12 are also gone. Found an approximately 25" diameter x 3' tall very rotten Hemlock stump with some axe marks visible. This Hemlock was found to be an unrecorded accessory to an unrecorded setting of a 3/4" iron bolt (was a 31" Hemlock stump bearing N 68° E 29.3'; scribes '1/' visible on rotted face -- see Rewitness Book 6, Page 260). (Book 6, Page 260) -- Found a 23" diameter uprooted Hemlock stump with a healed face (was a 15" diameter Hemlock tree bearing S 35° E 29.9' to face; scribed 1/4S14BT). (Book 6, Page 260) -- Found a 26" diameter x 2' tall Hemlock stump with a healed face buried in blow down (was a 12" diameter Hemlock tree bearing N 79° W 7.2' to face; scribed 1/4S15BT). (Book 6, Page 260) -- Did not find the 21" diameter Hemlock stump with an Oregon State Forestry Department metal location poster bearing N 58° E 31.2'. () Indicates record information from Tillamook County Survey Records.			
Monument Set (Procedures and Description): N/A	Sketch of Found Monument: 		
New accessories set: Set hat section post North 3.0'. Set a nail and aluminum washer stamped "TILL. CO. SURVEYOR" in a 25" diameter x 2' tall stump bearing S 28° 23' E (Grid bearing = S 30° 46' 24" E) at a distance of 45.20'. Set a nail and aluminum washer stamped "TILL. CO. SURVEYOR" in a 24" diameter x 3' tall stump bearing N 87° 37' E (Grid bearing = N 85° 14' 05" E) at a distance of 63.51'. Convergence = -2° 23' 55".			
New Bearing Trees set: No suitable Bearing Trees in the area.			
Location & Comments: Corner is located in the cutting line of a recent clear cut. The corner is in an area of recent blow down and located approximately 750' West from an existing logging road.		SURVEYOR'S SEAL <div style="border: 1px solid black; padding: 5px; display: inline-block; text-align: center;"> REGISTERED PROFESSIONAL LAND SURVEYOR </div> <i>Joseph V. Jensen</i> <div style="border: 1px solid black; padding: 5px; display: inline-block; text-align: center;"> OREGON JANUARY 10, 2008 JOSEPH V. JENSEN 60067 </div> <small>RENEWAL DATE: 06-30-2013</small>	
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141			
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor and Deputy County Surveyor			
Notes: Digital images were taken of the monument and its accessories.			
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor. Michael R. Rice, L.S.I. 16723, Survey Technician			

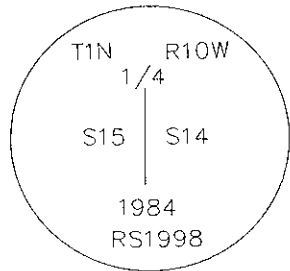