
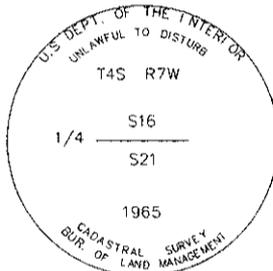


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 16	TOWNSHIP 4 South	RANGE 7 West
COUNTY: Tillamook		DATE: 12-22-11
CORNER DESIGNATION: The One-Quarter corner common to Sections 16 and 21, Township 4 South, Range 7 West, W. M.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input checked="" type="checkbox"/> Restoration
		<input type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Brass Cap set at surface
		<input type="checkbox"/> Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Note Volume: OR-R0118 Page: 0795; BLM Field Note Volume: OR-R0584 Page: 0230; Rewitness Book 3, Page 80; Rewitness Book 6, Page 176a and 176b; Map B-590, B-501, B-1559, Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found a 3" diameter BLM Brass Cap on a 28" x 2-1/2" iron post out of the ground in an area recently logged. We found the cap and iron pipe approximately 50' from record position. The found monument is stamped as shown hereon. Found a 50" diameter, 5' tall Douglas Fir stump with scribes partially visible at record position (was a 43" diameter Douglas Fir tree bearing North 48° West 97 links = 64.02' see Rewitness Book 3, Page 80). . Found a 36" diameter, Douglas Fir stump with a healed face and yellow metal location tag at record position (was a 20" diameter Douglas Fir tree bearing South 30-1/2° West 54 links = 35.64' see Rewitness Book 3, Page 80).		
Monument Set (Procedures and Description): We reestablished the disturbed monument using and holding the two found bearing tree stumps and calculating a distance/distance intersection from the found bearing trees. We believe we found the same hole that the pipe was located in when it was set in 1965 by the BLM. We reset the monument inside the found hole and a 12" diameter plastic cylinder filled with 120 pounds of concrete. We did not find the original stone or iron pipe deposited alongside brass cap and post as described in Rewitness Book 3, Page 80. The geodetic position was obtained by conventional methods (TOPCON GPT3005) from a GPS established meridian (SOKKIA GSR2700ISX Dual-frequency receivers) using the NGS HARN station BLAI. Latitude = 45° 12' 58.83529" N; Longitude = 123° 33' 21.44038" W		Sketch of Found Monument: 
New accessories set: Set a 72" long galvanized steel post with yellow metal location tag South 3.0' from the monument.		
New Bearing Trees set: 8" diameter Douglas Fir tree scribed "T4SR7WS16BT" which bears South 24° East 22.0'. 7" diameter Douglas Fir tree scribed "T4SR7WS16BT" which bears North 37° East 26.2'.		
Location & Comments: This corner is located at Bible Creek Ranch, behind a locked gate and approximately 1/2 miles North of Bible Creek Road.		
Firm / Agency: Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL  <i>Danny R. McNutt</i>  RENEWAL12-31-2012
Party Chief: Joe Jensen, PLS 60067, Deputy County Surveyor and Survey Supervisor;		
Notes: Digital images were taken of the monument and the accessories.		
Witnesses: Danny R. McNutt, PLS 49230, Tillamook County Surveyor. Michael R. Rice, L.S.I. 16723, Survey Technician		

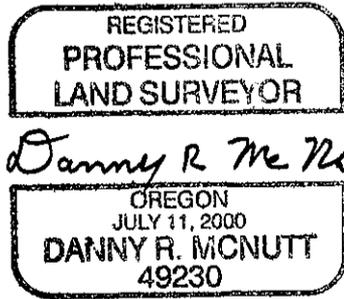