


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 3, 2, 10 and 11	TOWNSHIP 4 South	RANGE 10 West
COUNTY: Tillamook		DATE: 05-18-12
CORNER DESIGNATION: The Section Corner common to 3, 2, 10 and 11, Township 4 South, Range 10 west, W.M.		(Please check one)
		<input checked="" type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset
		<input type="checkbox"/> Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc.; BLM Field Note Volume: OR-R0180, Pages 166 and 167 1879; Rewitness Card #720; Map B-1048; Map B-1047, Map B-1141, Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found 3" diameter U.S.D.A. Forest Service aluminum cap, upright and in good condition. Placed 120 pounds of concrete and a 12" diameter plastic cylinder around monument. The monument is stamped as shown hereon. GLO 1879 Original – Was a 50" diameter Fir tree at S70°E 300 links [198']. Map B-1048 (1982) – Found a 50" diameter D. Fir snag with no visible marks at S70°E 199.2'. We found a 50" x 20' tall D. Fir with no marks at record position. Map B-1047 (1982) - 28" D. Fir S 71° E 36.3' scribed "T4SR10WS11BT"; We found a 38" diameter D. Fir tree with healed face at record position. Map B-1047 (1982) - 29" D. Fir S 08° W 11.6' scribed "T4SR10WS10BT"; We found a 37" diameter D. Fir tree with healed face at record position. Map B-1047 (1982) - 26" D. Fir N 85° W 57.4' scribed "T4SR10WS3BT"; We found a 32" diameter D. Fir tree with healed face at record position. Map B-1047 (1982) - 20" D. Fir N 24° E 9.3' scribed "T4SR10WS2BT"; We found a 25" diameter D. Fir tree with healed face at record position. Found a steel fence post with a yellow metal USFS tag attached bearing North 3'. Found a carsonite post bearing West 2'.		
Monument Set (Procedures and Description): Not Applicable.		Sketch of Found Monument: 
New accessories set: No new accessories were set.		
New Bearing Trees: No new bearing trees were set.		
Location & Comments: This corner is located approximately 200' West of an existing logging road.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 1510 Third Street, Suite C Tillamook, Oregon 97141		SURVEYOR'S SEAL <div style="border: 1px solid black; padding: 5px; text-align: center;"> REGISTERED PROFESSIONAL LAND SURVEYOR <i>Joseph V. Jensen</i> OREGON JANUARY 10, 2008 JOSEPH V. JENSEN 60067 RENEWAL DATE: 03-30-2013 </div>
Party Chief: Joe Jensen, PLS 60067, Survey Supervisor		
Notes: Digital photos have been taken of the monument.		
Witness: Danny R. McNutt, PLS 49230, Tillamook County Surveyor Michael R. Rice, PLS 86926, Survey Technician		

G:\completed restorations\T4SR10WS3,2,10,11.doc

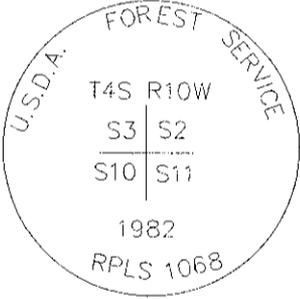