

TILLAMOOK COUNTY SURVEYORS OFFICE

Section Corner common to sections 7,8,17,& 18 T.2S., R.9W., W.M.

T2SR9W
S7 | S8

S18 | S17

RS 287
1972

I set a 10" cast iron monument case around found 2" iron pipe with 3" Tillamook County Brass Cap set in 1972, see Tillamook County Surveyors' rewitness #372.

History of found monument

I found this corner to be as described on surveyor rewitness #372 and its' accessory evidence found and/or set at that time to be as listed below:

- 1" I.P. S.9*20'W. 100.60', found now 100.53'.
- 2" I.P. S.89*46'E. 19.00', found in center of gateway 19.1'.
- "56" nail East 1.48', now under pavement not uncovered at this time.
- "56" nail North 2.01', Now under pavement not uncovered at this time.
- 1 1/2" I.P. S.86*W. 17.48', found okay in old fence line.
- Power Pole #4 P-55-L1 N.44*E. 27.45', found okay new PP# 171800
- 8" diameter post with finish nail in top S.86* W. 14.22', this post appears to have been hit from the road side and is now at a distance of 14.45' from the monument*.

New Accessory

84" hat section post 14.11, West*.


Monument Location

This corner is located approximately 2' West of the centerline of Bewley Creek County Road.

In the presence of Dan McNutt & Al Dvorak

February 1989

Title Allen E. Duncan, C.S.

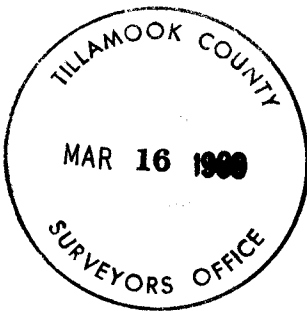

BOOK 6. 397