

# WEYERHAEUSER GOVT. CORNER VISITATION

SECTION 36 TOWNSHIP 2S RANGE 7W W.M. BLM ID# 100200

DLC \_\_\_\_\_ CORNER NORTHEAST

DATE 8/04/16 X CONDITION REPORT \_\_\_\_\_ RENEWED

### PREVIOUS RENEWALS/SURVEYS, ETC.:

G.L.O. 1879, USBT BOOK 2, PAGE 166, USBT BOOK 6, PAGE 372, B-2634, AND B-3087.

### MONUMENT (S) AND ACCESSORIES FOUND, CONDITION AND (ORIGIN)

- 3 3/4" ALUMINUM CAP, ON A 1 1/2" ALUMINUM PIPE, UP 6" IN MOUND OF STONES. (USBT BK 6, PG 372)  
FOUND A 3/4" FIBERGLASS POST 0.7' SOUTH OF MONUMENT
- 14" D.FIR, WITH A HEALED FACE AND YELLOW B.T. TAG, BEARS N33 1/2 °E, 28.5' (USBT BK 6, PG 372)  
(8" FIR, BEARS N38 °E, 27.4' TO FACE - USBT BOOK 6, PAGE 372)
- 21" D.FIR, WITH A HEALED FACE AND YELLOW B.T. TAG, BEARS S50 1/2 °E, 23.5' (USBT BK 6, PG 372)  
(14" FIR, BEARS S48 °E, 22.7' TO FACE - USBT BOOK 6, PAGE 372)
- 17" D.FIR, WITH A HEALED FACE AND D.O.F. B.T. TAG, BEARS S54 1/4 °W, 16.3' (USBT BK 6, PG 372)  
(11" FIR, BEARS S58 °W, 15.6' TO FACE - USBT BOOK 6, PAGE 372)
- 33" D.FIR, WITH A HEALED FACE AND D.O.F. B.T. TAG, BEARS N21 3/4 °W, 18.7' (USBT BK 6, PG 372)  
(24" FIR, BEARS N18 °W, 17.9' TO FACE - USBT BOOK 6, PAGE 372)

### MONUMENT (S) SET (PROCEDURES AND DESCRIPTION)

NONE

### NEW ACCESSORIES:

NONE

### COMMENTS:

ALL FACES WERE PAINTED BLUE, AS WAS A 6" BAND AROUND THE TREES.


DISTANCES TO THE BEARING TREES WERE MEASURED WITH A 75' BUCKERS TAPE TO AN EXISTING NAIL AT THE SIDE CENTER.

BEARINGS WERE COMPARED WITH A HAND COMPASS WITH THE DECLINATION SET AT 16 °E.

BEARINGS AND DISTANCES REPORTED ARE IN AGREEMENT WITH THOSE REPORTED IN B-3087.

THE 31" AND 54" STUMPS REPORTED IN B-3087 WERE ALSO FOUND AS REPORTED.

### MONUMENT DETAIL:

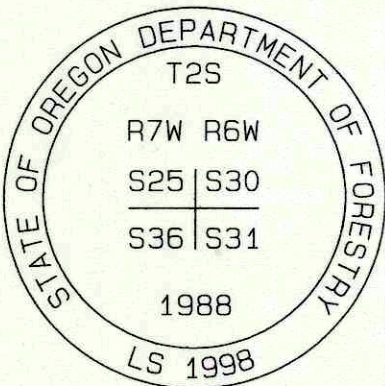

INMAN SURVEYING, LLC  
 1148 LISA CT NE  
 KEIZER, OR 97303  
 (541) 521-8311



REGISTERED  
 PROFESSIONAL  
 LAND SURVEYOR

*Kent Ryan Inman*

OREGON  
 JULY 13, 2004  
 KENT RYAN INMAN  
 60050LS

Expiration Date: 6/30/2017

SKETCH:  
 SCALE: 1" = 50'

