

TILLAMOOK COUNTY REWITNESS

#544

DATE: 29/28

SEC. 29/28

35 R 9

W., WM.

1/4 COR. A of A

TWO SHEETS A&B

Post #

HISTORICAL: GLO Page 22 10" Fir N68°W 156 chs

Book 53 Page 282 - Rewitness (1899) Fd 20" Fir B.T. @ N68°W 156 chs

(MAPS)	(MAPS)	Bk#	Pa#
B-554	F-17-1	53	60
B-511	F-40-56	53	282
A-941		4	45-69

CONDITION


FOUND:

NOW MISSING	POST	GLO.
FOUND <sup>Now 24" STUMP has been cut down</sup>	10" Fir N68°W 156 chains	GLO.
Found 3/4" Iron Pipe at	Correct bearing & distance from	
Original GLO Bearing Tree -	Refer Book 4 Page 45 & 69	
THE GLO 10" FIR B.T. IS MORE CORRECTLY CALLED A HEM-LOCK. A FACE IS PARTIALLY VISIBLE - MOSTLY ROTTED OFF.		

COMMENTS: W.S. COATES FOUND ORIGINAL B.T. IN 1929 Refer To BK 53 Pg 60

REWITNESS

1 SET 1/2" Iron Pipe with 3" Brass Cap Marked as sketched

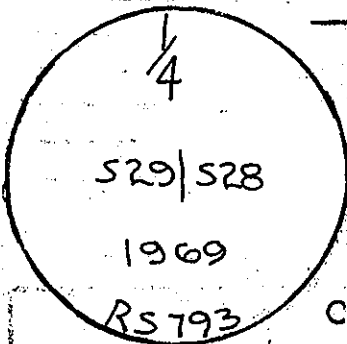

NEW ACCESSORY:

24" FIR	N65 1/2°W 45 83	1/4 S29 BTCS
36" SPRUCE	N36 3/4°E 119 37	1/4 S28 BTCS

COMMENTS: I set 1/2" Iron Pipe Over found 3/4" Iron Pipe.

CORNER IS ON SOUTH EDGE OF A BULLDOZER ROAD - CAT ROAD. CORNER IS 12 FEET NORTH OF NEW FENCE TO SOUTH. CORNER POSITION VERIFIED BY TRANSIT TIE OF 12 FEET AS COMPARED TO W.S. COATES TIE IN 1928 (Book 53 Page 60). "Beaver -> Blaine"

IN THE PRESENCE OF: ALLAN EARL DUNCAN RS793  
GEORGE WILLIAM URREY III

DATE: 1-24-69

COB\*  
1" PHOTO#; SEC\*

TILLAMOOK COUNTY REWITNESS TITLE