

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

Section corner common to Sections 1, 2, 35, and 36, T2-3N, R7W, W.M., Tillamook County, Oregon

ORIGINAL

Stone 24"x18"x5" now missing (everything North of the SW and SE BTs is in slide area) from which a:

- 24" Hem bears N78E 20 lks.; now missing (slide area).
- 20" Fir bears S3E 51 lks.; now 22" snag, scribes T2N R7W visible, other markings still covered.
- 24" Hem bears S24W 50 lks.; now 23" snag, upper face furnt out, lower face unexposed.
- 20" Fir bears N13W 50 lks.; now missing, evidence of roots found.

RESTORED

Set 1½"x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T3N R7W S35 S36 S2 S1 T2N 1955 RE2311," 33" in ground, in mound of stone, and from which a:


- 52" Fir stump bears N87W 76.4 ft.; scribed T3N R7W S35 BT.
- 30" Fir stump bears N57E 143.8 ft.; scribed T3N R7W S36 BT RE 2311.
- 10 ft. high by 12 ft wide rock face bears S64½W 28.0 ft; marked BO on upper left corner.

Set 4"x4"x72" painted white Cedar post 1.5 ft SE of pipe.  
Oregon State Board of Forestry metal location poster on 29" Fir snag S86W 43.9 ft.

Also poster on SE side of original 20" Fir BT S3E.  
Also poster on 30" Fir stump on S edge log road approx. 5 chs. S.

Dated July 14, 1955

Restored by Arnold G. Gibson under my direction  
Arnold G. Gibson, Asst. Engr.

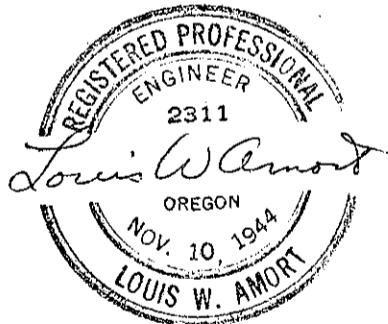

Present and witnessed by Richard Morris  
Forrest Logan  
Robert Stuem  
Lloyd Geraths