

CHAINS

REESTABLISHED CORNERS FOR OREGON STATE BOARD OF FORESTRY
(See official plat)

Center North one-sixteenth corner in Section 30,
T3S, R9W, W.M., Tillamook County, Oregon.

ESTABLISHED 1887 (see county records)

(no evidence of established corner found)

REESTABLISHED Var. $21\frac{1}{2}^{\circ}$ E

Set $1\frac{1}{2}$ " x 36" galvanized iron pipe with 3" bronze cap
marked "OREGON STATE BOARD OF FORESTRY N1/16 C-C
S30 1957 RS 359," 34 inches in ground, in mound of
stone, and from which a.

18" Spruce bears S38°E 39.8 feet; scribed CNL/16 S30
BT RS 359.

8" Alder bears N54°W 42.7 feet; scribed in bark
CNL/16 S30 BT.

Oregon State Board of Forestry metal location poster on
18" Spruce BT.

Set 4"x4"x60" white painted Cedar post 1.5' NW of pipe.

One quarter corner common to Sections 19 and 30,
T3S, R9W, W.M., Tillamook County, Oregon.

ORIGINAL

(no evidence of original corner found)

REESTABLISHED Var. $21\frac{1}{2}^{\circ}$ E

Set $1\frac{1}{2}$ " x 36" galvanized iron pipe with 3" bronze cap
marked "OREGON STATE BOARD OF FORESTRY $\frac{1}{4}$ S19 S30
1957 RS 359," 33 inches in ground, and from which a:

10" Fir bears S52°W 44.0 ft.; scribed $\frac{1}{4}$ S30 BT.



16" Fir bears N70°E 54.3 ft.; scribed $\frac{1}{4}$ S19 BT RS 359.

Oregon State Board of Forestry metal location poster on
16" Fir BT

Set 4"x4"x60" white painted Cedar post 2.0 feet SW of pipe.

Dated February 21, 1957.

Reestablished by Richard A. Morris under my direction.
Richard A. Morris, Transitman

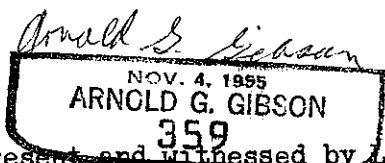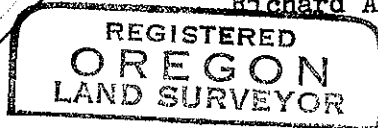

Present and witnessed by Lloyd Geraths and Robert Sturm