

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

Section corner common to Sections 20, 21, 28 and 29
T. 2S, R. 8W, W.M., Tillamook County, Oregon.

ORIGINAL

14" x 10" x 9" stone (now missing, found 1 1/4" x 4' pipe out of place - see below) from which a:

- 12" Cedar bears N63°W 84 lks.; now 32", face grown over.
- 24" Dead Cedar bears N35°E 15 lks.; now burnt out stub.
- 8" Alder bears S51°E 95 lks.; now missing.
- 8" Alder bears S52°W 27 lks.; now 14" exposed cast of scribe, rest of face covered.

RESTORATION by J. S. Forrest 1950, by authority of County Surveyor (See records)

Set 1 1/2" iron pipe 5' long (now 1 1/4" x 4') 2' in ground from which a:

- 8" Cedar bears N72°E 8 ft.; now 10", scribes T2S R8W S21 B visible.
- 20" Red Fir bears S36°E 39 ft.; now 22", face pitched over.

RESTORED

Var. 21 1/2°


Set above pipe in place according to original BTs, 36 inches in ground, in mound of rock, and from which a:

- 24" Fir bears S66°W 20.0 ft.; scribed T2S R8W S29 BT RS359.
- Above 8" Cedar bears N55°E 10.2 ft.
- Above 20" Red Fir bears S41°E 36.0 ft.

Set 4 x 4 x 72" white painted Cedar post 1.0 ft. SE of pipe.
Oregon State Board of Forestry metal location poster on 5 ft. x 20 ft. Cedar stub S8°E 31.4 ft.

Dated October 25, 1957

Restored by *David Steenson* David Steenson, Engineering Aide, under my direction.

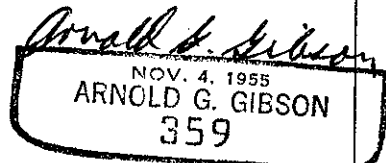

Present and witnessed by Gerald Schwalen
Clarence Skog
Donald Benty
Ray Baldwin

Book I