

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY
 One Quarter corner common to Sections 6 and 31,
 T. 2 & 3N, R. 9W, W.M., Tillamook County, Oregon.

ORIGINAL

Post (now missing, found 1" x 36" iron pipe in place, driven in edge
 of original BT Spruce Stump) from which a:

- 10" Spruce bears South 1 lk.; now 24" stump, scribes BT visible,
 upper face cut off when felled.
- 12" Hemlock bears N48W 30 lks.; point falls in log pile, no
 visible remains.

RESTORED By W. E. Anderson, county surveyor, November 24, 1950
 Set post (found N60W 6.4 Ft. from true corner point) from which a:

- 70" Cedar stump bears N86W 60.7 ft.; found scribed CS 1/4, now bears
 N81 1/2 W 66.3 FT.
- 80" Cedar stump bears S39W 101.75 ft.; found scribed CS 1/4, now bears
 S47W 103.3 Ft.

RESTORED Var. 21 1/2 E


Set 4" x 4" x 60" white painted Cedar post 1.5 Ft. N.E. of above pipe
 and from which a:

- 4" Alder bears N61W 3.8 ft.; scribed in bark, 1/4 S31 BT.
- 7" Alder bears S9 1/2 W 22.6 ft.; scribed in bark, 1/4 S6 BT RS 401.


Oregon State Board of Forestry metal location on 4" Alder BT.
 Moved county surveyor's post, with his permission, N10W 1.4 Ft.
 from pipe.

Dated March 6, 1958

Restored by

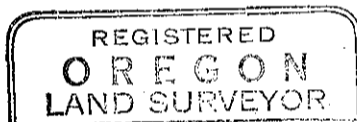

Richard A. Morris

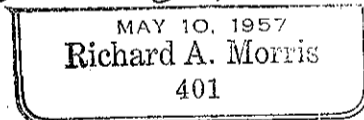

Present and witnessed by Robert Sturm
 Harold Russell