

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

Township corner common to Sections 1, 6, 31 and 36,
T 1 & 2 N, R9 & 10 W, W.M., Tillamook County, Oregon

ORIGINAL

Post (now missing) from which a:

- 60" Cedar bears S65W 27 lks.; now 96" uproot, downhill out of place, roots and root hole in place, no face visible.
- 12" Hemlock bears N34W 32 lks.; now 37", scribes S36 visible on partly exposed face.
- 17" Hemlock bears N40E 32 lks.; now just root hole remaining in place.

RESTORED


Set 1½" x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T2N R10W R9W S36 S31 S1 S6 T1N 1957 RS401," 33 inches in ground, in small mound of stone, and from which a:

- 21" Hemlock bears S25W30.4 ft.; scribed T1N R10W S1 BT RS401.
- 46" Spruce bears S19E 29.0 ft.; scribed T1N R9W S6 BT.
- 43" Hemlock bears N21E 15.9 ft.; scribed T2N R9W S31 BT.
- Original 37" Hemlock bears N34W 21.1 ft.; scribed BT on overgrowth.


Oregon State Board of Forestry metal location poster on 46" Spruce BT set 4" x 4" x 60" white painted Cedar post 1.0' N.E. of pipe.

Dated January 24, 1958

Restored by:

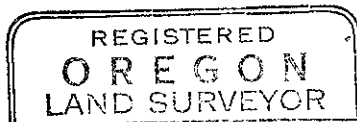

Richard A. Morris

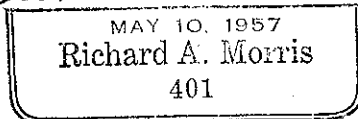

Present and witnessed by Robert Sturm
Harold Russell