

(25)

CHAINS

SURVEY FOR THE OREGON STATE BOARD OF FORESTRY

January 10, 1951

Restoration of the section corner to Sections 15, 16, 21 and 22, Township 2 North, Range 6 West, W.M., Tillamook and Washington Counties, Oregon.

Var. 22° E.

The point for corner determined from the remains of the original bearing trees:

A fir stump, 44 inches in diam., bears S 75° W, a distance of 5.3 feet (8 lks). Exposed scribe marks 21.

A hemlock snag, 27 inches, in diam., bears N 60° W, a distance of 13.2 feet (20 lks). Parts of scribe marks visible on edges of burnt out face.

Distances taken from races.

Did not find evidence of other bearing trees or corner stone.

At the corner point:

Set a 1½ inch iron pipe, 3 feet long, with an Oregon State Board of Forestry bronze cap stamped: T2N R6W S16 S15 S21 S22 1951 199.

From which:



A fir stump, 40 inches in diam., bears S 75° E, a distance of 33.0 feet, scribed: S22 199 BT.

A fir snag, 40 inches in diam., bears N 23° E, a distance of 53.0 feet, scribed: T2N R6W S15 199 BT.

A fir snag, 40 inches in diam., bears N 67° W, a distance of 34.5 feet, scribed: S16 199 BT.

Placed a metal location poster on a 40 inch fir stump and marked it: Sec.22 T2N R6W Sec. Cor. 31.0 ft. N 75° W.

The above work done by Don Davis, Transitman; Richard Morris and Bill Kleeman, Chainmen; and John McWade, Flagman; under my direction.

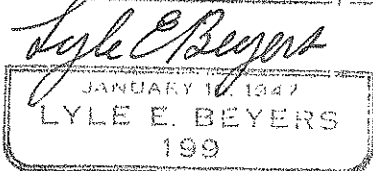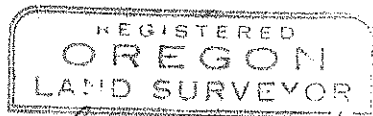

Lyle E. Beyers
Forest Engineer