

TILLAMOOK COUNTY SURVEYORS OFFICE
COURT HOUSE, TILLAMOOK OREGON 97141

SECTION CORNER COMMON SECTIONS 15, 16, 21, & 22 T.3S., R.10W., W.M.

T3SR10W I found a 2" iron pipe with a 2" Brass cap set by
S16| S15 Tom O. McCullough LS 650, (see T.C.S. Rewitness Book
----+---- 3 at Page 320). I encased the found iron pipe and
S21| S22 brass cap in a 10" concrete cylinder.
1969
650

History of found monument

I found this monument to be as described in T.C.S. Rewitness Book 3 at page 320, and the references found and/or set at that time to now be as follows:

(Original) 10" hemlock S.70°E. 14 lks, there is no report of this bearing tree ever being found, however, I found a 10" rotten stub approximately 3' tall with very old back cast of scribe marks "BT" visible when I removed what appeared to be scar material over a face, bears S.70°E. 26.38', possibly should have been recorded originally as 40 lks instead of 14 lks.

(Original) 12" hemlock N.82°E. 19 lks, Reported in Book 3 at Page 271 as a 14" hemlock stub with scribe marks visible, and Reported in Book 3 at Page 320 as a 4' high stub, and reported on T.C.S. Map #B-1085 as a rotten hemlock stump; (Found, now a 4' high rotten stub, N.82°E. 19 links, scribing visible).

(Original) 10" hemlock N.64°W. 16 lks, Reported in Book 3 at page 271 as a 12" hemlock stump with rotten slab at base with scribe marks visible, and Reported in Book 3 at Page 320 as a 1' high stump with slab marked "S16", and reported on T.C.S. Map #B-1085 as remains of hemlock stump; (Found, now rotten remains in roots of 36" BT reported below N.64°W 16 links).

(Whitmore Book 3 Page 271) 36" hemlock N.67°W. 12.4, reported in Book 3 at page 320 as a 36" hemlock at position, and reported on T.C.S. Map B-1085 as a 30" hemlock N.67°W. 11.9' scribing visible; (Found, now 32" hemlock healed blaze N.67°W. 11.9' to a nail in the North side center of the tree).

(Whitmore Book 3 Page 271) 3 1/2" hemlock N.32°E. 4.1 feet, and reported in Book 3 at page 320 as a 4" hemlock N.32°E. 4.2', and reported on T.C.S. Map B-1085 as an 8" hemlock N.32°E. 4.5'; (Found, now 9" hemlock with healed blaze N.32°E. 4.5' to a nail in the Easterly side center of the tree).

(Whitmore Book 3 Page 271) 4 1/2" hemlock S.63°W. 10.2 feet, and reported in Book 3 at page 320 as a 6" hemlock S.63°E. 10.0', and reported on T.C.S. Map B-1085 as a 10" hemlock S.63°W. 10.5', healed face; (Found, now 12" hemlock with healed face S.63°W. 10.5, to nail in Northerly side center of the tree).


(Book 3 Page 320) 5" hemlock S.85°E. 16.3 feet, and reported on T.C.S. Map B-1085 as a 10" hemlock S.85°E. 16.3'; (Found, now an 12" hemlock with healed blaze S.85°E. 16.3' to nail in North side center of tree).

Found steel fence post with yellow U.S.F.S. tag 1.5' northerly of corner.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Page 1 of 2

Allan E. Duncan, C.S.
OREGON
JULY 14, 1967
ALLAN E. DUNCAN
793

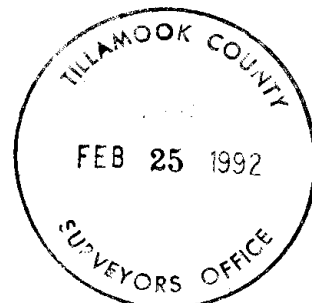

TILLAMOOK COUNTY SURVEYORS OFFICE
COURT HOUSE, TILLAMOOK OREGON 97141

SECTION CORNER COMMON SECTIONS 15, 16, 21, & 22 T.3S., R.10W., W.M.

New Accessory

*72" light hat section post East 1.5'.

*indicates Tillamook County Surveyors yellow metal location poster attached.

Surveys and Rewitnesses of record

Rewitness Book 3 Page 271	2-9-67	Leonard Whitmore U.S.F.S.
Rewitness Book 3 Page 320	1969	Tom O. McCullough LS 650
B-1085	12-24-82	Edgar R. Cook LS 1073 & David K. Bateman LS 1068
G.L.O. Book 3S10 Page 29	8-14-1882	Wm. P. Wright Contract #442

Monument Location

This corner is located at West side of a recent clear cut in a North-South cutting line approximately 20' East of a fire trail.

I also found a U.S.F.S. Metal location poster on a 4" alder on the Westerly side of a logging road approximately 300' S.6°E. of the corner.

In the presence of Dan McNutt and Al Dvorak

February 6, 1992

Title:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Allan E. Duncan, C.S.

OREGON
JULY 14, 1967
ALLAN E. DUNCAN
793

Page 2 of 2

