

RESTORED CORNER FOR OREGON DEPARTMENT OF FORESTRY  
4907 Third St., Tillamook, Oregon 97141

One quarter corner common to Sections 23 and 24, T1N, R10W, W.M., Tillamook County, Oregon.

ORIGINAL by C.J. Handley, July 5, 1873.

Post; missing.

6" Hemlock bears S85°E 12 lks.; missing.  
32" Hemlock bears S20°W 16 lks.; missing.  
Summit of Point bears North 2.00 chns.; Top of ridge bears North 10.0 ft. course N80°W.

REESTABLISHED by Richard A. Morris LS401, December 31, 1959 (Book 2, page 438 and Plat #B-419 Tillamook County Records).

1½"x36" Galvanized iron pipe with 3" bronze cap 30 inches in the ground, in mound of stone; found out of place in root ball of tree uproot.

26" Fir bears S23°W 38.2 ft.; now a 27"x7 ft. high stump, face closed.  
25" Fir bears N82½°W 26.2 ft.; now a 29"x2½ ft. high stump, face closed.  
Metal location poster on 16" Hemlock N25°W 1.0 ft.; Now a 24"x2½ ft. high uprooted stump.  
4"x4"x60" white painted Cedar post 1.5 ft. SE of pipe; found laying on ground, out of place.  
Top of ridge bears North 10.0 ft. course N80°W; in place.

RESTORED November 7, 1996

Var. 19½°E

Reset above pipe with marks "LS1998-1996" added, 30" in ground, in mound of stone, from which a:

29" Fir bears S73°E 37.2 ft. to face; scribed 1/4S24BT  
23" Fir bears S07½°W 8.5 ft. to face; scribed 1/4S23BT.  
6" Hemlock bears N11°W 8.5 ft. to face; scribed 1/4S23BT

Metal location poster on new BTs.


3/4" brass washer marked "LS1998" nailed to face of new BTs.

6 ft. Orange carsonite post bears N51°E 0.6 ft.

4"x4"x60" white painted Cedar post bears S58°E 2.3 ft.

Present and witnessed by David B. Buchholz and Clifford R. Foster

Restored by

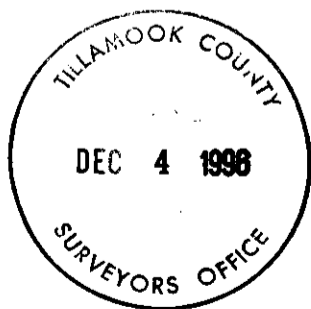

SURVEYED BY:

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Anthony J. Klosterman*

OREGON  
July 21, 1982  
Anthony J. Klosterman  
1998

6505 GRANDVIEW HGTS.  
TILLAMOOK, OR 97141  
EXPIRES JUNE 30, 1997