

REWITNESSED CORNER FOR OREGON DEPARTMENT OF FORESTRY  
4907 Third St., Tillamook, Oregon 97141

Standard section corner common to Sections 35 and 36, T1N, R7W,  
W.M., Tillamook County, Oregon.

ORIGINAL by William Ives, June 25, 1851.

Post; missing, point falls in road.

20" Hemlock bears S02°E 37 lks.; now a 18" x 6 ft. high badly  
rotted uprooted stub.

10" Hemlock bears S52°E 31 lks.; missing, point falls in road.

12" Hemlock bears N63°W 16 lks.; missing, point falls on edge  
of road.

18" Hemlock bears N13°W 21 lks.; missing, point falls in road.

RESTORATION by Henry Meldrum, September 6, 1884.

Post; missing, point falls in road.

RESTORATION by Arnold G. Gibson LS359, May 28, 1957 (Book 2,  
page 384, Tillamook County Records).

1½"x36" galvanized iron pipe with 3" bronze cap, 8 inches below  
road surface; in place 5 inches below road surface.

36" Fir stump bears N76°E 38.2 ft.; now 5 ft. high with  
scribes T1NR7WS36BTRS359 visible.

39" Fir stump bears N37°W 142.0 ft.; now 4 ft. high and rotted  
with scribes T1NR7WS35B visible.

4"x4"x60" white painted Cedar post bears West 11.3 ft.; now  
in place, badly rotted.

REWITNESSED September 21, 1999

Var. 18½°E

From above pipe with marks "LS1998-1999" added a:

14" Fir bears N10°E 41.1 ft. to face; scribed T1NR7WS36SCBT.

14" Fir bears N58½°E 30.0 ft. to face; scribed T1NR7WS36SCBT.

21" Fir bears N38°W 62.5 ft. to face; scribed T1NR7WS35SCBT.


Metal location poster on new Bts and Amort's 36" Fir stump BT.

3/4" brass washer marked "LS1998" nailed to face of new Bts.

6 ft. orange carsonite post bears S88°W 12.4 ft.

Present and witnessed by David B. Buchholz LS2272 and Clifford R.  
Foster.

Rewitnessed by

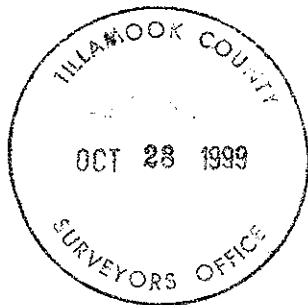

SURVEYED BY:

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Anthony J. Klosterman*

OREGON  
July 21, 1982  
Anthony J. Klosterman  
1998

4907 THIRD STREET  
TILLAMOOK, OR 97141  
EXPIRES JUNE 30, 2001