

RESTORED CORNER FOR OREGON DEPARTMENT OF FORESTRY
4907 Third St., Tillamook, Oregon 97141

One quarter corner common to Sections 19 and 20, T3N, R8W, W.M.,
Tillamook County, Oregon.

ORIGINAL by Henry Meldrum, October 27, 1891.

24"x12"x8" Basalt stone 18" in ground with 1/4 on west face;
missing, found 2½" x 6" long portion of a burnt fir limb with
rotted point in place.

- 40" Cedar bears N56°E 32 lks.; now a 63" x 2 ft. high rotted
stump. Fir limb is at bearing and distance from apparent
lower portion of rotted face.
- 20" Hemlock bears S25°W 10 lks.; missing.

On top of spur slopes SE; in place.
Head of gulch bears N0°05'W 4.00 chains course SE; in place.
N0°05'W 13.25 chains, pass 10 ft. west of perpendicular rock
10 ft. high, on hillside; in place.
Found one old grown over blaze on this line.

RESTORED October 14, 1999


Var. 18½°E

Set a 1½"x30" galvanized iron pipe with 3 3/4" bronze cap marked
T3NR8W½S19S201999LS1998, 28" in ground, in mound of stone, in
place of fir limb, placed fir limb portion 0.4 ft. SW of pipe,
and from which a:

- 14" Fir bears N44½°E 10.5 ft. to face; scribed 1/4S20BT.
- 8" Fir bears S34½°E 42.6 ft. to face; scribed 1/4S20BT.
- 18" Double Fir bears S39½°W 9.2 ft. to face; scribed
1/4S19BT.
- 27" Fir bears N23½°W 38.65 ft. to face; scribed 1/4S19BT.

Metal location poster on new BTs.
3/4" brass washer marked "LS1998" nailed to face of new BTs.
6 ft. orange carsonite post bears S55°E 2.85 ft.
Present and witnessed by Clifford R. Foster.

Restored by David B. Buchholz under my direction.
David B. Buchholz, LS2272

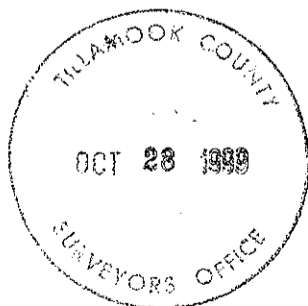

SURVEYED BY:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Anthony J. Klosterman

OREGON
July 21, 1982
Anthony J. Klosterman
1998

4907 THIRD STREET
TILLAMOOK, OR 97141
EXPIRES JUNE 30, 2001