

RESTORED CORNER FOR OREGON DEPARTMENT OF FORSTRY
4907 Third St., Tillamook, Oregon 97141

One quarter corner common to Sections 29 and 30, T2N, R7W, W.M.,
Tillamook County, Oregon.

ORIGINAL by Henry Meldrum, September 17, 1891.

17"x14"x8" basalt stone, 11" in ground with 1/4 on West face;
missing.

15" Hemlock bears S28°E 71 lks.; missing, point falls at
base of rock face.

30" Hemlock bears S49°W 38 lks.; now 27"x 1 ft. high badly
rotted root crown.

Low spur ridge bears N00°05'W 50 lks., slopes NW; in place,
slopes N80°W.

Spur bears S00°05'E 2.50 chs., slopes NW; now 193 ft.,
slopes S79°W.

NOTE: One other 1891 corner in this township is known to be set
from the BT face.

RESTORATION September 20, 2000

Var. 18½°E

1½"x30" galvanized iron pipe with 3 3/4" bronze cap marked "STATE
OF OREGON DEPARTMENT OF FORESTRY T2N R7W 1/4 S30 S29 2000 LS1998",
14" in ground, in a 9 ft. x 9 ft. 4 ft. mound of stone, at base
of rock face, and from which a:

13" Fir bears N00½°E 35.3 ft. to face; scribed 1/4S29BT.

Rock outcrop bears S53½°E 12.1 ft. to face; marked XBO.

9" Alder bears S21½°W 41.6 ft. to barkscribes; 1/4S30BT.

13" Fir bears N79°W 34.9 ft. to face; scribed 1/4S30BT.


Metal location poster on new BTs.

3/4" brass washer marked "LS1998" nailed to face of new BTs.

6 ft. orange carsonite post bears S81°E 1.7 ft.

Present and witnessed by Clifford R. Foster, Chris R. Woodward.

Restored by David B. Buchholz under my direction.
David B. Buchholz, LS2272

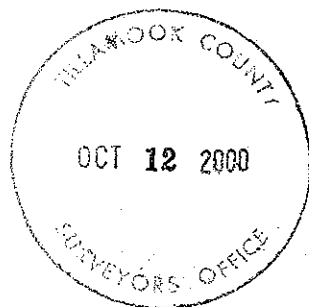

SURVEYED BY:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Anthony J. Klosterman

OREGON
July 21, 1982
Anthony J. Klosterman
1998

4907 THIRD STREET
TILLAMOOK, OR 97141
EXPIRES JUNE 30, 2001