
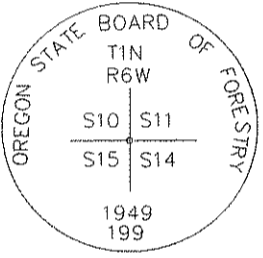


**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
**Tillamook County Surveyor's Office**

<b>SECTION:</b> Southeast corner of Section 10	<b>TOWNSHIP</b> 1 North	<b>RANGE</b> 6 West
<b>COUNTY:</b> Tillamook		<b>DATE:</b> 08-17-07
<b>CORNER DESIGNATION:</b> The Section corner common to Sections 10, 11, 15, 14, Township 1 North, Range 6 West, W.M., Tillamook County, Oregon.	<b>(Please check one)</b>	
	<input type="checkbox"/>	Condition Report Only
	<input type="checkbox"/>	Restoration
	<input checked="" type="checkbox"/>	Rewitness
	<input type="checkbox"/>	Unrecorded
	<input type="checkbox"/>	Reset at surface
<input type="checkbox"/> Referenced Out		
<b>Previous Rewitnesses, Restorations and Surveys, etc.:</b> See Rewitness Book 1, Page 48A, Tillamook County Survey Records.		
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found a 3" diameter Oregon State Board of Forestry bronze cap on a galvanized iron pipe in dirt. Found a large Douglas Fir stump at the record location of an original 46" diameter bearing tree as described in Rewitness Book 1, Page 48A. Found the remains of a rotten snag approximately 1.0' tall at the record location of a 22" Hemlock snag as described in Rewitness Book 1, Page 48A.		
<b>Monument Restoration (Procedures and Description):</b> Set a 12" diameter plastic cylinder and 120 pounds of concrete around found Bronze Cap and pipe. Also placed stones around the base of the plastic cylinder.	<b>Sketch of Found Monument::</b>	
		
<b>New accessories set:</b> **Set a 72" light hat section post 5.0' North of corner.		
<b>New Bearing Trees:</b> **20" diameter Douglas Fir tree scribed " T1NR6WS14BT" with a nail and red plastic cap stamped "Tillamook Co. Survey" set between the scribed 'B & T' which bears South 10° East 5.9 feet to the corner. **17" diameter Douglas Fir tree scribed " T1NR6WS15BTX" with a nail and red plastic cap stamped "Tillamook Co. Survey" set between the scribed 'B & T' which bears South 58° West 27.3 feet to the corner. **17" diameter Douglas Fir tree scribed "T1NR6WS11BTX" with a nail and red plastic cap stamped "Tillamook Co. Survey" set between the scribed 'B & T' which bears North 52° East 25.5 feet to the corner. **26" diameter Douglas Fir tree scribed " T1NR6WS10BT" with a nail and red plastic cap stamped "Tillamook Co. Survey" set between the scribed 'B & T' which bears North 84° West 29.2 feet to the corner. ** Indicates yellow metal location tag set with corner accessory.		
<b>Location &amp; Comments:</b> This corner is located approximately 200 feet East of an existing logging road (Chicken Road).		
<b>Firm / Agency</b> Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE	<b>SURVEYOR'S SEAL</b>   <i>Danny R. McNutt</i>	
<b>Party Chief:</b> Joe Jensen, PLS 60067, Survey Supervisor		
<b>Notes:</b>		
<b>Witness:</b> Danny R. McNutt, PLS 49230, Tillamook County Surveyor		

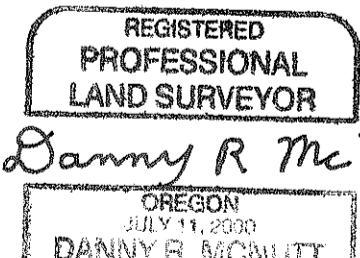