
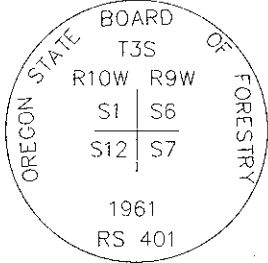


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 1,6,7 &12	TOWNSHIP 3 South	RANGE 9 & 10 West	
COUNTY: Tillamook		DATE: 12-11-08	
CORNER DESIGNATION: The section corner to common to Section 1 and Section 12, Township 3 South, Range 10 West, W.M. and Section 6, 7 Township 3 South, Range 9 West, Tillamook County, Oregon.		(Please check one)	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Reset
		<input type="checkbox"/>	Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc.: G.L.O. Pg. 8, 3S9 set stone not found by 3S10 survey. G.L.O. Pg. 6, 3S10 set post. Hayse-104. Book 1 Page 1, Book 2 Page 481. Maps B-729, B-69, A-901, B-1073, see re-witness card #577 all found in Tillamook County Survey Records.			
Found Monument(s) and Accessories (Condition & Source): Found an Oregon State Board of Forestry 3" diameter brass cap stamped as shown hereon. Found monument in cement flush with the ground. Found hat section post with a tag N 70° E 1.7' and a white cedar post lying down. (Field note BIN Pg. 52) Found 28" diameter Spruce Stump, 2' tall, rotted, at record position. (Field note BIN Pg. 52) Did not find the 8" Spruce Stump at record position. (Field note BIN Pg. 52) Found 36" diameter Hemlock Stump, 2.5' tall, rotted, at record position. (Field note BIN Pg. 52) Found 36" diameter Hemlock Stump, 2' tall, rotted, at record position. (Book 2, Page 481) Found 28" diameter Spruce Stump, 3' tall, rotted, at record position. (Book 2, Page 481) Found rotted pile at record position of a 20" Hemlock Stump. (Re-witness #577) Found 18" (was 14") Alder at N 4° E 6.6 Feet, healed scar.			
Monument Set (Procedures and Description): Not Applicable.		Sketch of Found Monument: 	
Other new accessories set: Tagged the 18" Alder at N 4° E 6.6 feet.			
New Bearing Trees: 9" diameter Hemlock bears N 43° E 30.3 feet, scribed "T3S R9W S6 BT", tagged and painted. 7" diameter Hemlock bears S 18° E 15.5 feet, scribed "T3S R9W S7 BT", tagged and painted. 6" diameter Double-Hemlock bears S 39° W 33.7 feet, scribed "T3S R10W S12 BT", tagged and painted. 12" diameter Hemlock bears N 78° W 9.7 feet, scribed "T3S R10W S1 BT", tagged and painted. All new bearing trees have a nail and aluminum washer marked, "Till. Co. Surveyor" in the face of the tree between the scribed B & T.			
Location & Comments: This corner is located approximately 100' South of a creek in an overgrown clear cut area.			
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE		SURVEYOR'S SEAL 	
Party Chief: Joe Jensen, PLS 60067, Survey Supervisor			
Notes:			
Witness: Danny R. McNutt, PLS 49230, Tillamook County Surveyor Michael R. Rice, LSI 16723, Survey Technician			

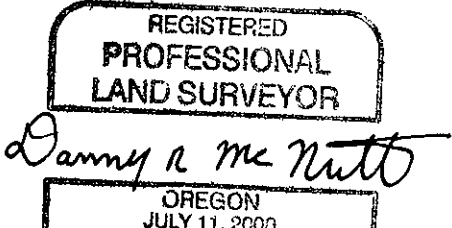