


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 1,2,11 and 12	TOWNSHIP 3 South	RANGE 10 West	
COUNTY: Tillamook		DATE: 12-12-08	
CORNER DESIGNATION: The Section Corner to common 1,2,11 and 12.		(Please check one)	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Reset
Previous Rewitnesses, Restorations and Surveys, etc.: G.L.O. 3S10 Page 14, 1882, Rewitness Card #581, Rewitness Book 6 Page 486, all found in Tillamook County Survey Records.			
Found Monument(s) and Accessories (Condition & Source): Found 3" brass cap in good condition, in cement, in monument case, 0.3' below lid of monument casing. The monument is stamped as shown hereon. (Book 6, Page 486) – Found 40" stump, 6' tall, face overgrown, "Do not cut" tag nailed to stump, at record position. (Book 6, Page 486) – Found 28" stump, 7' tall, rotten face, scribing partially visible, at record position. (Book 6, Page 486) – Found 20" stump, 7' tall, rotten face, scribing partially visible, at record position. (Book 6, Page 486) – Found 1" I.P., 4' tall, at record position. (Book 6, Page 486) – Found 21" (was 14") diameter Hemlock, bears S 84° W 41.5' (S 82° W 41.7'), scar and tag healed. (Book 6, Page 486) – Found hat section post, bears N 27° E 19.4'. () Indicates record information from Rewitness Book 6, Page 486.			
Monument Set (Procedures and Description): Not Applicable.	Sketch of Found Monument: <div style="text-align: center;">  </div>		
Other new accessories set: Re-tagged the hat section post at record position.			
New Bearing Trees: * 17" diameter Cedar bears N 82° E 52.7', scribed "T3S R10W S1 BT", tagged and painted. * 12" diameter Hemlock bears S 45° E 61.3', scribed "T3S R10W S12 BT", tagged and painted. * 10" diameter Fir bears N 5° W 52.9', scribed "T3S R10W S2 BT", tagged and painted. All new Bearing Trees have a nail and aluminum washer marked, "Till. Co. Surveyor" in the face of scribe between the B and T. *Indicates yellow Tillamook County Corner tag affixed.			
Location & Comments: This corner is located in the center of an 18' wide, oiled, East\West running logging road. Approximately 30' east of the intersection of a gravel logging road running North.			
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE		SURVEYOR'S SEAL <div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> REGISTERED PROFESSIONAL LAND SURVEYOR <i>Joseph V. Jensen</i> OREGON JANUARY 10, 2008 JOSEPH V. JENSEN 60067 RENEWAL DATE: 06-30-09 </div>	
Party Chief: Joe Jensen, PLS 60067, Survey Supervisor			
Notes:			
Witness: Danny R. McNutt, PLS 49230, Tillamook County Surveyor Michael R. Rice, LSI 16723, Survey Technician			

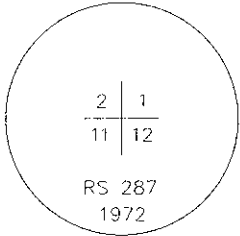