
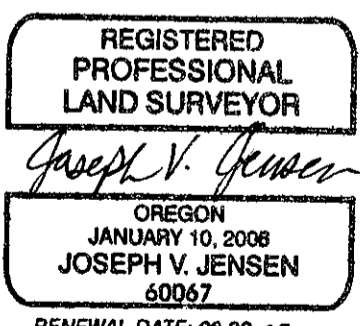


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 3	TOWNSHIP 3 South	RANGE 10 West	
COUNTY: Tillamook		DATE: 3-26-09	
CORNER DESIGNATION: The Quarter Corner Common to Sections 3 and 10, T. 3 S., R. 10 W., W.M.		(Please check one)	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Reset at surface
		<input type="checkbox"/>	Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0272 Page 142 (GLO 3S10 Pg. 32) (1882), M. Whitmore (1948), Map A-1008 (1962), Book 6, Page 50 (1964), Rewitness #583 (1976), BLM Field Notes Volume: OR-R0609 Page 383 (Book 6, Page 97) (1978), Map B-833 (1979), Tillamook County Survey Records.			
Found Monument(s) and Accessories (Condition & Source): Found a 3" B.L.M. Brass Cap flush with ground, in a sawed out downed tree. The monument is stamped as shown hereon. Found a carsonite post and fence post with National Forest Property Boundary Tags. (G.L.O.) – Did not find the (12" dia. Fir bearing S 84° E 30 lks.). (G.L.O.) – Did not find the (10" dia. Hemlock bearing S 67° W 17 lks.). (Whitmore 1948) – Found root hole (was 14" dia. Hemlock) bears (S 24° E 18 lks.). *(Rewitness #583) – Found 36" Fir Stump, 3' tall, bears N 9° E (N 4° W) 18.5' (19.4'), axe work visible, tag. *(Rewitness #583) – Found 22" Hemlock Stump, 6' tall, bears (S 50° W) 20.2' (22.1'), scribing visible, tag. * All found distances are to face, Record distances are to side-center. () Indicates record information, Tillamook County Survey Records.			
Monument Set (Procedures and Description): Not applicable.		Sketch of Found Monument: 	
New accessories set: Set 120 lbs. of concrete in a 12" diameter cylinder around monument. Set a hat section post with a yellow metal location poster North 3.0' from monument.			
New Bearing Trees set: 9" diameter Hemlock bears N 2° E 16.3', scribed, "1/4 S3 BT CS", tagged and painted. 9" diameter Hemlock bears S 70° W 5.4', scribed, "1/4 S10 BT CS", tagged and painted. All new bearing trees have a nail and aluminum washer marked, "Till. Co. Surveyor", in face of blaze, between the scribed B and T, and a yellow metal location tag affixed.			
Location & Comments: Corner is located approx. 280' south of a logging road, on a steep slope.			
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL 	
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor			
Notes:			
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician			

