
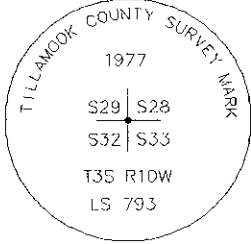


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: SW Corner of 28	TOWNSHIP 3 South	RANGE 10 West	
COUNTY: Tillamook		DATE: 4-16-09	
CORNER DESIGNATION: The Section Corner Common to Sections 28, 29, 32 and 33, T. 3 S., R. 10 W., W.M.		(Please check one)	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Reset at surface
		<input type="checkbox"/>	Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0272 Page 145 - 146 (GLO 3S10 Pg. 34 - 35) (1882), Book 3 Page 273 (1967), Rewitness #639 (1977), Map B-883 (1979), Map B-993 (1981), Map B-1166 (1984), Tillamook County Survey Records.			
Found Monument(s) and Accessories (Condition & Source): Found a 3" Tillamook County Brass Cap up 0.5', in 10" diam. tile and cement with rock collar, in good condition. The monument is stamped as shown hereon. Found hat section post, bent and lying next to the monument. (G.L.O.) – Found rotten stub (was 8" Hemlock) bears (N 54° W 17 lks.). (G.L.O.) – Did not find the (8" Hemlock bearing N 14° E 5 lks.). (G.L.O.) – Did not find the (6" Hemlock bearing S 34° W 16 lks.). (G.L.O.) – Found rotten stump (was 7" Hemlock) bears (S 44° E 20 lks.). (Book 3, Page 273) – Found 36" Fir Stump, 3' tall, bears (S 54°30' W) 15.9' (18.5'), scribing "BT" visible, tag. () Indicates record information, Tillamook County Survey Records.			
Monument Set (Procedures and Description): Not applicable.	Sketch of Found Monument: 		
New accessories set: Set a 72" hat section post with a yellow metal location tag affixed, East 3.0' from monument.			
New Bearing Trees set: 16" diam. Hemlock bears N 38°30' W 26.8', scribed, "T3S R10W S29 BT", tagged and painted. 16" diam. Hemlock bears N 41° E 19.8', scribed, "T3S R10W S28 BT", tagged and painted. 13" diam. Hemlock bears S 5° E 3.7', scribed, "T3S R10W S33 BT", tagged and painted. 13" diam. Fir bears S 71° W 17.9', scribed, "T3S R10W S32 BT", tagged and painted. All new bearing trees have a nail and aluminum washer in the face of the scribe between the "B and T". The washer is marked, "Till. Co. Surveyor, and a yellow metal location tag affixed.			
Location & Comments: Corner is located on a side slope descending southerly +/- 100' from the bottom of a dry gulch, +/- 400' West of a USFS road.			
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL	
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor			
Notes:		RENEWAL DATE: 06-30-09	
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician			

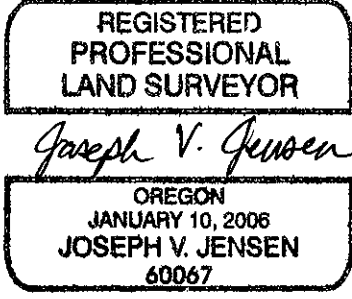