
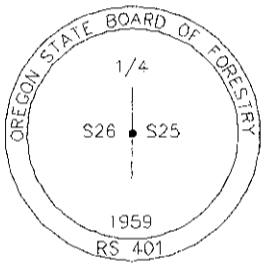


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 25 and 26	TOWNSHIP 2 South	RANGE 9 West
COUNTY: Tillamook		DATE: 7-22-09
CORNER DESIGNATION: The Quarter Corner common to Sections 25 and 26.		(Please check one)
		<input checked="" type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
<input type="checkbox"/> Referenced Out		
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0309 Page 969 (GLO 2S9 Page 53) (1884), Rewitness Book 1 Page 384-384A (1959), Map B-404 (1959), Map A-875 (1961), Map B-449 (1961), Rewitness Card #411 (1985), Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found a 3" dia. O.S.B.F. Brass Cap, in cement, with a rock collar, up 0.5', good condition. The monument was set in Rewitness Book 1, Page 384-384A (1959). The monument is stamped as shown hereon. Found a hat section post with a yellow metal location tag, North 2.0' from monument. (G.L.O.) – Did not find the (Cedar 10 ins diam bears S 43° E 46 lks [30.36'] dist). (G.L.O.) – Did not find the (Hemlock 4 ins diam bears S 30°15' W 33 lks [21.78'] dist). (Book 1, Page 384-384A) – Found 17" diam. Hemlock (was 7") bears (S 29 1/2° E 51.9') with a healed scar and tag. (Book 1, Page 384-384A) – Found 19" diam. Hemlock (was 5") bears (N 69° W 13.4') with a healed scar and tag. (Book 1, Page 384-384A) – Found 17" diam. Alder (was 11") bears (N 45° E 3.0') with a yellow metal location tag. () Indicates record information, Tillamook County Survey Records. [] Indicates converted value from links to feet.		
Monument Set (Procedures and Description): Not applicable.	Sketch of Found Monument: 	
New accessories set: Not applicable.		
New Bearing Trees set: Not applicable.		
Location & Comments: Corner is located approx. 200' North of a logging road, approx. 300' North of Simmons Creek and approx. 0.2 miles Northwesterly from where old logging road crosses Simmons Creek on old log bridge.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor		<div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> REGISTERED PROFESSIONAL LAND SURVEYOR </div> 
Notes: Digital images were taken of the monument, the found bearing trees and the terrain.		<div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> OREGON JANUARY 10, 2008 JOSEPH V. JENSEN 60067 </div> RENEWAL DATE: 08-30-2011
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician		

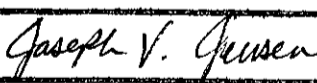