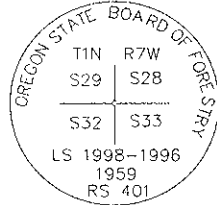
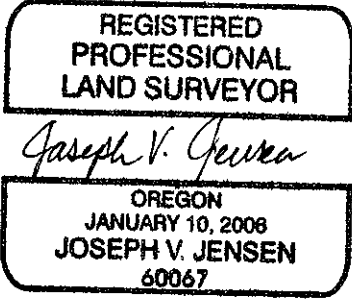


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: The Southeast Corner of Section 29	TOWNSHIP 1 North	RANGE 7 West	
COUNTY: Tillamook		DATE: 09-30-10	
CORNER DESIGNATION: The Section corner common to Sections 28, 29, 32 and 33, Township 1 North, Range 7 West, W.M., Tillamook County, Oregon.		(Please check one)	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Reset at surface
Previous Rewitnesses, Restorations and Surveys, etc.: BLM Field Notes Volume: OR-R0309 Page 363; Tillamook County GLO Book 1N7W, Pg. 61 (1884), Rewitness Book 7, Page 245 (1996); Rewitness Book 2, Page 423 (1959); Tillamook County Survey Records.			
Found Monument(s) and Accessories (Condition & Source): Found a 3" diameter Oregon State Board of Forestry Brass cap, flush on a steep hillside. We used metal posts and 120 pounds of concrete to reinforce the down-hill side of the monument. We then placed a 12" diameter plastic cylinder and 120 pounds of concrete around monument. Found a broken and rotten white painted cedar post lying on the ground next to the found monument. All original GLO bearing trees are gone. Found a 27" diameter Fir tree with a healed face, at position (was a 7" diameter Fir tree bearing South 37° East 129.2' Rewitness Book 2, Page 423). Found a 5' tall x 48" rotten Cedar stump with visible scribing, at position (was a 48" diameter Cedar stump bearing North 27-1/2° West 41.7' Rewitness Book 2, Page 423). Found a 6' tall x 52" rotten Fir stump with no visible scribing, at position (was a 52" diameter Fir stump bearing North 04° East 38.6' Rewitness Book 2, Page 423). The 10" diameter Alder tree bearing North 75-1/2° East 82.3 feet is gone (See Rewitness Book 7, Page 245). Found a 34" diameter Fir tree with healed face and yellow metal location tag, at position (was a 22" Fir tree bearing South 56-1/2° West 76.5 feet see Rewitness Book 7, Page 245). Found a 24" diameter Fir tree with healed face and yellow metal location tag, at position (was a 15" Fir tree bearing North 72-1/2° West 55.9 feet see Rewitness Book 7, Page 245).			
Monument Set (Procedures and Description): N/A		Sketch of Found Monument: 	
New accessories set: Set a 72" Hat Section post with yellow metal location tag South 2.0' from monument. We set a 30" x 5/8" rebar with a red plastic cap stamped "Till. Co. Surveyor" which bears North 38° 34' 17" East 153.25' from the monument. We also set a 30" x 5/8" rebar with a yellow plastic cap stamped "Till. Co. Random" which bears North 63° 29' 15" East 271.53' from the monument. The bearings and distances are grid values. Convergence = -2° 10' 11.72611", grid scale factor = 0.99991495. Conventional field tie of the monument using dual-frequency GPS control. The control points are single-occupation GPS observations. Northing = 695965.854, Easting = 7418275.085, U.S. survey foot; '83/'91' NAD Oregon North Zone, State Plane Coordinate.			
New Bearing Trees Set: 17" diameter Douglas Fir tree scribed "T1NR7WS28BT" which bears North 36° East 216.7'. The new bearing tree has a nail and aluminum washer marked, "Till. Co. Surveyor", in face of blaze, between the scribed S and 28, and a yellow metal location tag affixed to the tree.			
Location & Comments: This corner is located on a very steep hillside above a Northerly flowing creek approximately 150 feet Southerly of the South Fork of Jordan Creek Road.			
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL	
Party Chief: Joe Jensen, PLS 60067, Survey Supervisor			
Notes: This rewitness was done to perpetuate the location of the found monument; no measurements were taken to confirm its position relative to any section subdivision. Digital images were taken of the found monument, the new monument, the record bearing trees and new accessories.		OREGON JANUARY 10, 2006 JOSEPH V. JENSEN 60067 RENEWAL DATE: 06-30-2011	
Witness: Danny R. McNutt, PLS 49230, Tillamook County Surveyor; Michael R. Rice, L.S.I. 16723, Survey Technician		