
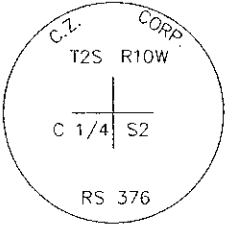


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: Section 2	TOWNSHIP 2 South	RANGE 10 West
COUNTY: Tillamook		DATE: 08-02-11
CORNER DESIGNATION: The Center One-quarter Corner of Section 2, T. 2 S., R. 10 W., W.M.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset
Previous Rewitnesses, Restorations and Surveys, etc.: Survey map B-555, Tillamook County Survey Records.		
<p>Found Monument(s) and Accessories (Condition & Source): Found a 3" diameter C.Z. CORP. brass cap 1' above the ground. The monument is upright and in good condition. We placed a 12" diameter plastic cylinder around the found monument and filled the cylinder with 120 pounds of concrete. The monument is stamped as shown hereon. Found the very rotten remains of the white 4" x 4" wood post on the ground next to the monument. (Map B-555) – Found a 38" diameter X 6' tall rotten Hemlock stump with scribing and an orange painted face visible. There are two yellow metal location tags still on the tree. The stump is leaning to the Northeast and is located at the top of a steep North facing slope, (was a 36" diameter Hemlock tree bearing N 50° E 9.5'). The measurement to the face is now 10.0' due to the Northeast lean of the stump. (Map B-555) – Found a 30" diameter very rotten Hemlock stump at record position (was a 28" diameter Hemlock tree bearing S 15° E 29.2'). A portion of a face is visible but the face is collapsing inward away from the monument.</p>		
Monument Set (Procedures and Description): Not Applicable.	Sketch of Found Monument: 	
<p>Other new accessories set: Set a 72" hat section post with yellow metal location tag bearing East 3.0'. Placed a yellow metal bearing tree tag on an existing metal fence post along the South edge of the pasture. The top of the metal fence post is painted orange. The corner bears approximately South 25° West 350' from the metal fence post and tag.</p>		
<p>New Bearing Trees: *9" dia. Hemlock tree bears S 22° W 2.3', scribed "C1/4S2BT", tagged and painted. *12" dia. Hemlock tree bears S 80° E 8.9', scribed "C1/4S2BT", tagged and painted. *14" dia. Hemlock tree bears N 02° W 5.2', scribed "C1/4S2BT", tagged and painted. Note: All new bearing trees have a nail and plastic washer marked, "Tillamook County Surveyor" in face between B and T. * Indicates a yellow metal location tag attached.</p>		
<p>Location & Comments: This corner is located on a ridge at the terminus of a steep trail about 20' above an old cat logging road. "PLEASE PROTECT NEARBY SURVEY MARKER" was placed on a tree along the trail to the corner.</p>		
<p>Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141</p>		SURVEYOR'S SEAL  RENEWAL DATE: 06-30-
<p>Party Chief: Joe Jensen, PLS 60067, Survey Supervisor</p>		
<p>Notes: Digital images were taken of the monument and the new accessories.</p>		
<p>Witness: Danny R. McNutt, PLS 49230, Tillamook County Surveyor Michael R. Rice, LSI 16723, Survey Technician</p>		

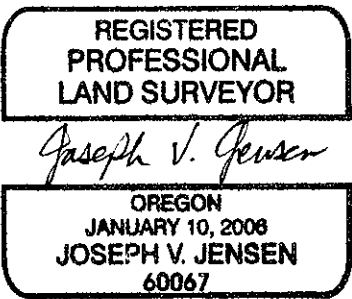