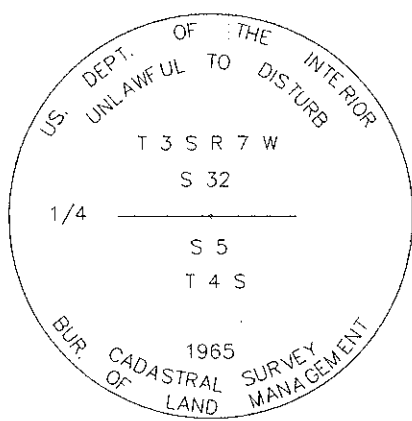
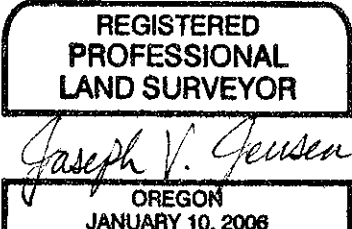


**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
Tillamook County Surveyor's Office

<b>SECTION: 32</b>	<b>TOWNSHIP 3 South</b>	<b>RANGE 7 West</b>
<b>COUNTY: Tillamook</b>		<b>DATE: 08-03-11</b>
<b>CORNER DESIGNATION:</b> The Quarter Corner common to Section 32, T. 3 S., R. 7 W., Section 5, T. 4 S., R. 7 W., W.M.		<b>(Please check one)</b>
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
<input type="checkbox"/> Referenced Out		
<b>Previous Rewitnesses, Restorations and Surveys, etc:</b> BLM Field Notes Volume: OR-R0118, Page 0617; BLM Field Notes Volume: OR-R0584, Page 0225; Tillamook County Surveyor GLO Book 4S7 Page 3; Survey Maps B-773, B-1106; Tillamook County Rewitness Book 6, Page 176.		
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found a 3" diameter Bureau of Land Management Brass Cap, flush with the ground. Monument is stamped as shown hereon. Found the original (12"x12"x10" in original notes) stone in the ground next to the monument with the scribed 1/4 face up. We measured 10"x10"x18" for the size of the stone. (Original GLO Field Notes Volume: OR-R0118, Page 0617) – No bearing trees set. Found a 44" diameter x 3' tall Fir stump with healed face at record position and with a yellow metal location tag attached. (Was a 30" diameter Fir tree which bears N. 1 1/2° E., 85 1/2 lks. [56.43'] dist., mkd. 1/4 S32 BT in BLM Field Notes Volume: OR-R0584, Page 0225). Found a 43" diameter x 4' tall Fir stump at record position, top of stump is angle cut with a partially rotted face and a scribed S5 B still visible. No yellow metal location tag was found on the tree. (Was a 31" diameter Fir tree which bears S. 19° E., 70 1/2 lks. [46.53'] dist., mkd. 1/4 S5 BT in BLM Field Notes Volume: OR-R0584, Page 0225).		
( ) Indicates record information, Bureau of Land Management Survey Records. [ ] Indicates converted value from links to feet.		
<b>Monument Set (Procedures and Description):</b> N/A	<b>Sketch of Found Monument:</b> 	
<b>New Accessories set:</b> Set 120 lbs. of concrete in a 12" dia. cylinder around monument. Set 72" hat section post 2.0' North of the monument.		
<b>New Bearing Trees Marked:</b> * 58" diameter Douglas Fir bears N 47° 30' W 57.9', scribed "T3S R7W 1/4 S32 BT", tagged and painted. * 15" diameter Douglas Fir bears S 10° 30' E 19.0', scribed "T4S R7W 1/4 S5 BT", tagged and painted. * Indicates an aluminum nail with a washer stamped "Till. Co. Surveyor" is set in the face between the scribed "B" and "T".		
<b>Location &amp; Comments:</b> Monument is located approx. 100' North of a road intersection of road TC2 and 3-7-31.		
<b>Firm / Agency</b> Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		<b>SURVEYOR'S SEAL</b>
<b>Party Chief:</b> Joe Jensen, P.L.S. 60067, Survey Supervisor		
<b>Notes:</b> Digital images were taken of the monument and its accessories.		RENEWAL DATE: 03-30-2013
<b>Witnesses:</b> Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician		