
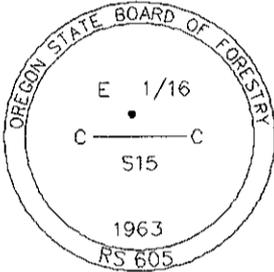



**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
Tillamook County Surveyor's Office

<b>SECTION: 15</b>	<b>TOWNSHIP 1 South</b>	<b>RANGE 9 West</b>	
<b>COUNTY: Tillamook</b>		<b>DATE: 11-1-11</b>	
<b>CORNER DESIGNATION:</b> The Center-East Sixteenth Corner of Section 15, T. 1 S., R. 9 W., W.M.		<b>(Please check one)</b>	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Referenced Out
<b>Previous Rewitnesses, Restorations and Surveys, etc:</b> Map A-1100 (1963), Tillamook County Survey Records.			
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found 3" dia. Oregon State Board of Forestry Brass Cap flush and in good condition. Monument was originally set in 1963 and noted on map A-1100. Found a white painted cedar post lying near monument. (Map A-1100) – Found rotten Hemlock stump, 7' tall (was 24" Hemlock bears S 61° E 52.1'), axe marks visible. (Map A-1100) – Did not find the (16" Hemlock bearing N 23° E 20.3').  ( ) Indicates record information, Tillamook County Survey Records.			
<b>Monument Set (Procedures and Description):</b> N/A	<b>Sketch of Found Monument:</b>  		
<b>New Accessories set:</b> Set 100 lbs. of concrete in a 12" dia. cylinder around monument. Set a 72" hat section post with a yellow metal location tag, 3.0' North of the monument. Re-set white painted cedar post 1.0' East of monument.			
<b>New Bearing Trees Marked:</b> *16" dia. Hemlock bears S 42° E 58.4', scribed "CE1/16S15BT", tagged and painted. *53" dia. Spruce bears S 49° W 48.7', scribed "T1SR9WCE1/16S15BT", tagged and painted. * Indicates an aluminum nail with washer marked, "Till. Co. Surveyor" in the face of the blaze between the scribed "B" and "T". Also, a yellow metal location tag affixed in an upper blaze.			
<b>Location &amp; Comments:</b> Monument is located approx. 150' west of a Sugarloaf Road.			
<b>Firm / Agency</b> Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		<b>SURVEYOR'S SEAL</b>	
<b>Party Chief:</b> Joe Jensen, P.L.S. 60067, Deputy County Surveyor			
<b>Notes:</b> Digital images were taken of the monument and its accessories.			
<b>Witnesses:</b> Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician			

RENEWAL DATE: 06-30-2013

