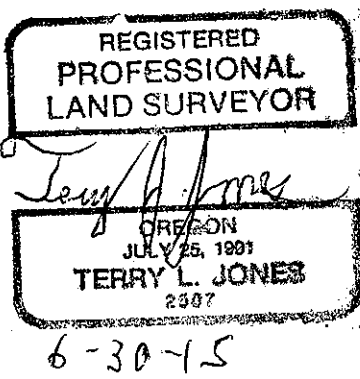


**OREGON PUBLIC LAND CORNER REPORT/RESTORATION REPORT**  
Tillamook County Surveyor's Office

<b>SECTION:</b> 14	<b>TOWNSHIP:</b> 2 SOUTH	<b>RANGE:</b> 9 WEST
<b>COUNTY:</b> TILLAMOOK COUNTY		<b>DATE:</b> 14-Aug-13
<b>CORNER DESIGNATION:</b> WEST 1/4 CORNER OF SECTION 14 ONLY		<b>(Please Check One)</b>
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Not Found
		<input type="checkbox"/> Reset
		<input type="checkbox"/> Referenced Out
<b>Previous Rewitnesses, Restorations, Surveys, etc.:</b> MAP B-1225, MAP B-1154, & B-1495		
<b>Found Monument(s) and Accessories(Condition &amp; Source):</b> FOUND BRASS CAP STAMPED "T2S R9W 1/4 S14 1985 LS 793" FROM WHICH: ALUMINUM CAP STAMPED " W1/4 S14 PS 929 1984" BEARS (N 83°59'42" W 2.34); 20" (16") ALDER BARK SCRIBE VISIBLE ( S 2°14'W 31.83); 47" (22") SPRUCE WITH HEALED FACE (N 89°06'W 37.30); 50" (30") SPRUCE WITH HEALED FACE (S 34°30' E 58.15); STEEL POST WITH LOCATION TAG NORTH 1FT		
<b>Monument Set(Procedures &amp; Description):</b>		<b>Sketch of Cap</b>
<b>Other New Accessories Set:</b> SET 5/8" X 40" REBAR WITH PLASTIC CAP "TERRY JONES LS 2507" (S 1°23'56" W) 39FT ON SECTION LINE WITH ORANGE CARSONITE POST 1FT NORTH, SET 5/8" X 40" REBAR WITH PLASTIC CAP "TERRY JONES LS 2507" ( S 1°23'56" W) 81 FT ON SECTION LINE WITH ORANGE CARSONITE POST 1FT NORTH		
<b>New Bearing Trees:</b>		
<b>Location &amp; Comments:</b> CENTERLINE OF KILLAM CREEK IS 20' NORTH, COURSE N75°W CENTERLINE OF LOGGING ROAD IS 90' SOUTH; BRASS CAP IS NOW ON THE SOUTH EDGE OF THE CREEK		<b>Surveyor's Stamp</b> 
<b>Firm/Agency:</b> BAYSIDE SURVEYING		
<b>Address:</b> 11765 HWY101 SOUTH TILLAMOOK, OR 97141		
<b>Party Chief:</b> TERRY JONES		
<b>Notes:</b> REWITNESS/2S-9W-S14-W1-4.xls FILE IN OFFICE		Office Use Only
<b>Witness(es):</b> KYLER JONES DALLAS ESPLIN		