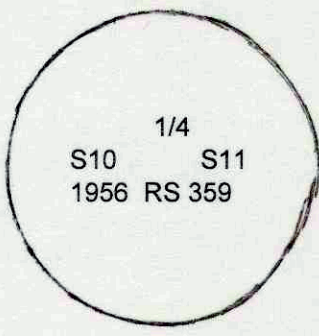
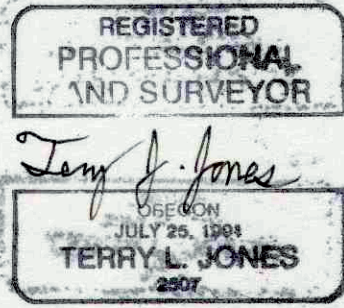


OREGON PUBLIC LAND CORNER REPORT/RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 10 & 11	TOWNSHIP: 1N	RANGE: 7W
COUNTY: TILLAMOOK	DATE: JUNE 16, 2016	
CORNER DESIGNATION: 1/4 CORNER COMMON TO SECTIONS 10 & 11, T1N, R7W.	(Please Check One)	
	<input type="checkbox"/> Condition Report Only	
	<input type="checkbox"/> Restoration	
	<input checked="" type="checkbox"/> Rewitness	
	<input type="checkbox"/> Not Found	
	<input type="checkbox"/> Reset	
<input type="checkbox"/> Referenced Out		
Previous Rewitnesses, Restorations, Surveys, etc.: 		
Found Monument(s) and Accessories(Condition & Source): FOUND OREGON STATE BOARD OF FORESTRY BRASS CAP ON 2" IRON PIPE STAMPED "1/4 S10 S11 1956 RS 359", 2" ABOVE GROUND, FROM WHICH: 72" FIR STUMP WITH HEALED FACE BEARS N 27° W 43.3'; 96" CEDAR STUMP WITH LOCATION TAG BEARS N 86° E 51.8', SEE MAP A-639.		
Monument Set(Procedures & Description):		
Other New Accessories Set: SET CARSONITE POST 1' NORTH.		
New Bearing Trees: 32" DOUG FIR SCRIBED "1/4 S11 BT" BEARS S 63° E 55.14' TO BRASS NAIL AND WASHER; 17" DOUG FIR SCRIBED "1/4 S10 BT" BEARS S17° W 8.70' TO BRASS NAIL AND WASHER; THE BRASS NAILS AND WASHERS ARE SCRIBED "LS 2507" AND BETWEEN THE B & T.		
Location & Comments: CORNER FALLS ON WEST EDGE OF NEW LOGGING ROAD AND EAST EDGE OF 100' WIDE FLAT. YMLT IS N40 W225' AT ROAD, ON 10" ALDER.		Surveyor's Stamp  RENEWAL DATE 6-30-17
Firm/Agency: BAYSIDE SURVEYING		
Address: 11765 HWY 101 SOUTH TILLAMOOK, OR 97141		
Party Chief: TERRY JONES		
Notes: FILE NAME rewitness\T1N-R7W-S10-E1-4.xls		Office Use Only
Witness(es): TLJ/DWE		