


Index File No. **J-9** 5S R. 9W Merid. **Willamette**  
 CORNER RECORD (SEARCH) (Ref. FSM 7151.4) Tract or Survey No. **#821** Cor. No. **821**  
 R.D. **Hebo** County **Tillamook** State **Oregon**  
 N.F. **Siuslaw**

CORNER DIAGRAM

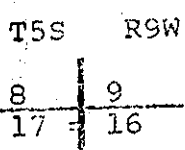

DESCRIBE CORNER MONUMENT FOUND  
 Found 3/4" iron pipe N62W 5.6 ft from true corner position based on the 1895 C.S.

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND  
 48" fir snag brs. S59E 68.0 ft - with tag - scribin visible ( set in 1895)  
 40" fir snag brs. N05E 13.2 ft - face rotted out - (set in 1895) (record bearing N20E)  
 10" fir snag brs. N45W 54.7 ft  
 14" fir brs. S45W 34.3 ft  
 Above 2 BTs found from 3/4" pipe - 30 yrs old

PHOTO IDENTIFICATION DATA  
 Photo No. \_\_\_\_\_  
 Filed At. \_\_\_\_\_  
 Object Ident. \_\_\_\_\_  
 Ident. By \_\_\_\_\_  
 Signature \_\_\_\_\_

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER  
 Access from Hebo - go south on Hwy 22 for 6 1/2 mile until you cross E&W section line - go 1300 ft due west to section corner.

PLANE COORDINATE POSITION DATA  
 State \_\_\_\_\_ Zone \_\_\_\_\_

Signature **T. O. McCullough** Title **Surveyor** Headquarters \_\_\_\_\_ Date **1/16/70** 7100-52

CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT  
 Set 2"x30" iron pipe with brass cpp mkd T5S R9W  
 8 | 9  
 17 | 16  
 1970  
 650

ACCESSORIES: DESCRIBE NEW BT'S WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE  
 14" fir brs. S51W 37.0 ft - with tag  
 10" fir snag brs. N50W 60.6 ft - with tag  
 Left 3/4" pipe in original position  
 Set 2 fence posts with signs + 5 ft east facing south  
 + 5 ft south facing east

Work Done By **T. O. McCullough** Title **Surveyor** Date **1/16/70** State Registration No. **ORLS 650**  
 or Agency  
 Certified Cor. Record Prepared? Yes No Filed At: \_\_\_\_\_ Date \_\_\_\_\_

REMARKS

witnesses to the above corner: **Dick Rust**  
**Ben Brown**